

True Fitness Service Manual

Treadmills

Models 350-750

True fitness technology, Inc. makes no representations or warranties regarding the contents of this manual. We reserve the right to revise this document at any time or to make changes to the product described within it without notice or obligation to notify any person of such revisions or changes.

© 2004, True Fitness, Inc. All rights reserved. Printed in the United States of America.

865 Hoff Road. O'Fallon, MO 63366. 1-800-426-6570. Fax 636-272-3026.

www.truefitness.com

Revision 9/2004

Treadmill Preventative Maintenance Checklist

- ❖ Run calibration or run a manual program and watch and listen for anything out of the ordinary.
- ❖ Perform a push off test (page T-7) to check for proper lubrication. If excessive friction is found and lubrication doesn't correct the problem perform the amp draw test (page T1-2)
- ❖ Inspect the belt surfaces, topside should still have texture for grip, bottom should be porous fabric- not glazed, smooth or hard.
- ❖ Inspect deck surface, should be free of scratches, abrasions or blistering.
- ❖ Listen for excessive bearing noise, from a standing position, in the front and rear roller and motor.
- ❖ Check for front roller/belt slippage and belt tension adjustment. Look for slippage on drive pulley.
- ❖ Inspect/ adjust tracking of belt.
- ❖ Vacuum out motor area, being careful not to damage PWM.
- ❖ Inspect drive belt for wear and cracking.
- ❖ Wipe down machine- leave it in better condition than you found it.

True Fitness Treadmill Service Manual

START

- ❖ **Symptom guide**
- ❖ **Calibration Procedures**
- ❖ **Diagnostic Procedures**
- ❖ **Test Procedures**
- ❖ **Wiring Diagrams**
- ❖ **Part Manuals**

SYMPTOM GUIDE

▢	Error Code Definitions	Page 3, 4
▢	No Belt Movement	Page 5, 6
▢	Tread Belt Stops During Workout	Page 7
┘	Heart Rate Not Working / Erratic Readings	Page 8
┘	Elevation Not Functional	Page 9
▢	Speed Fluctuation: E2 Cal	Page 10
▢	Speed Fluctuation: S4, E5, E2 E3: EPROM	Page 11
▢	No Display	Page 12
▢	Circuit Breaker Trips at Start Up	Page 13
▢	Soft Select Malfunctions	Page 14, 15
┘	Calibration Procedures	Page 16
┘	Diagnostics	Page 17

Symptom	Probable Cause	Corrective Action	Recommended Tools
ERROR MESSAGES:			
S1 L LUBE	Indicates that the accumulated distance is such that the deck needs to be lubed	Lube deck with True Fitness liquid silicone lubricant. Inspect wax bar assembly on commercial models, if worn to less than ¼ inch in thickness- replace wax bar.	Liquid silicone single use pack Liquid Silicone Applicator. Vacuum Shop towel
S2 C CLEAN	Indicates that the accumulated distance is such that the machine needs to be cleaned.	Remove motor cover and vacuum dust from area. Wipe down the exposed area of the deck beside the straddle covers with a clean, dry cloth.	
S3 M MOTOR	Indicates that the accumulated time on the treadmill is such that the motor brushes need to be changed/checked.	- Check/Replace motor brushes as needed. - Reset timer.	
E5 S SPEED SENSOR	Cannot read speed sensor	Perform Speed Sensor Test page 21	
E1 S STALL.	Incline reading not changing when commanded	See Elevation Not Functional page 9.	
E1 I INCLINE	Incline reading has changed without the incline being commanded.	See Elevation Not Functional page 9.	
E1 R RANGE	Maximum or minimum elevation out of calibrated ranges	See Elevation Not Functional page 9.	

Symptom	Probable Cause	Corrective Action	Recommended Tools
ERROR MESSAGES: (cont'd)			Multi-meter Phillips head screwdriver
E2 O OVERSPEED	Belt speed ramping too fast.	Perform Amp Draw Test – Page 20. Perform Belt / Deck Wear Test – Page 24.	
E2 C CALIBRATE	Micro-controller cannot adjust belt speed to target.	Calibrate Treadmill – Page 16. See appropriate Symptom Guide – pages 10-11.	
E3 E EEPROM	Software error during treadmill startup diagnostics.	Restart Treadmill, if error persists- replace control panel.	
E2 R RECALIBRATE	Treadmill has lost calibration settings.	Recalibrate Treadmill – Page 16. (If unit loses programs- replace control panel)	

Symptom	Probable Cause	Corrective Action	Recommended Tools
NO BELT MOVEMENT	Treadmill in need of calibration.	Run calibration. (page 16) -----	Multi-meter PWM / Motor test cables Note: All trouble shooting should be performed in calibration mode. Page 16
	Missing command to PWM.	Is PWM light blinking/ illuminated when fast button is pushed? NO- Check continuity on wire harness, if harness has continuity breaks replace the harness. If harness has continuity- replace the upper panel. Refer to wiring harness diagram for your model. YES- move on to next step, wire harness and control panel are OK. -----	
	Missing/incorrect voltage to motor.	- With treadmill in calibration mode (page 16) - Set speed at 4 MPH - Check VDC across MTR 1 and MTR 2 <u>with the motor leads connected to the motor</u> the voltage should measure 10 VDC for every 1 MPH. - If voltage is missing or low- Replace PWM. - If voltage is greater than 20 VDC/MPH motor may have open windings.	
	Damaged motor.	----- - With PWM LED Blinking/ Illuminated- move the tread belt with your foot to see if motor begins to move on its own. - If motor begins to move, inspect the condition of the brushes and the commutator. - If brushes are bad- replace brushes - If motor doesn't turn or has a damaged com segment- replace motor. Continue on next page...	

Symptom	Probable Cause	Corrective Action	Recommended Tools
NO BELT MOVEMENT (cont'd)	Motor turns but belt does not.	- Check belt tension. - Set belt tension to 1/8-inch deflection or correct tension can be verified by twisting the belt almost to a 90-degree position.   -----	Note: All trouble shooting should be performed in calibration mode. Page 16
	Belt cannot be moved manually-foreign object under belt.	Remove foreign object. Perform the Amp Draw Test (page 20) to check for excessive amp draw damage	

Symptom	Probable Cause	Corrective Action	Recommended Tools
TREADBELT STOPS DURING WORKOUT Error Code displays: Go to page 3 & Page 4.	Loose safety key connection	• Check safety key to ensure that it is seating properly. • Check connection sensitivity. -----	Liquid silicone single use pack Liquid silicone Applicator Multi-meter Socket set Note: All trouble shooting should be performed in calibration mode. Page 16
	Belt movement issue	• If treadmill will not reset with cycling the power go to NO RFI.T MOVEMENT (pages 5 & 6) -----	
	Worn Deck / Belt	• Perform Belt / Deck Wear Test (page 24). • Perform Amp Draw Test (page 20). • Apply silicone. • Replace Deck and Belt. -----	
	Occurs when making changes to speed or elevation	• May be related to electro static discharge. Contact Technical support for assistance. -----	
	Overloaded house circuit	• Verify the treadmill is on a dedicated circuit with at least a 15 amp breaker • Have customer supply a dedicated circuit -----	
	Conduity, connection to motor	• Reconnect or replace motor wires or connectors -----	
	Tread belt not centered or obstructed	• Tension tread belt (page 22) • Center tread belt • Remove obstruction	

Symptom	Probable Cause	Corrective Action	Recommended Tools
SPEED FLUCTUATION E2: CAL	Speed Fluctuation (Due to high friction)	- Perform Push Off Test (page 24) - Perform Amp Draw Test (page 20) -----	Multi-meter Socket Set Silicone Lubrication Packet Silicone Lubrication Applicator
	Speed Fluctuation (Due to Voltage fluctuation)	- Check Line voltage for fluctuations. - Have customer take corrective action. -----	Note: All trouble shooting should be performed in Calibration Mode: See SG-12
	Bad Data Feedback	- Verify tach feedback accuracy through out the speed range. - If inaccurate perform speed sensor test (page 21) -----	
	Incorrect Speed Sensor Gap	- Verify correct Speed sensor Gap. - Gap should be equal to the thickness of (3) credit cards pressed together (approximately 1/8 to 1/4 inch) -----	

Symptom	Probable Cause	Corrective Action	Recommended Tools
SPEED FLUCTUATION S4: Sensor E5: Speed Sensor E2: Overspeed E3: EPROM Error	No Belt Movement	Go to page 5, 6.	Multi-meter
	No/Intermittent Tach Feedback	- Enter Calibration mode (page 16) - Verify speed feedback in speed display through out the speed range. [Speed display should never show 0 mph when belt is moving] - If no tach feedback is available perform speed sensor test (page 21). - Check continuity of tach feedback portion of the data cable (To identify tach feed back lines see wiring diagram section for specific model).	Socket Set Silicone Lubrication Packet Silicone Lubrication Applicator
	Overspeed Error	- Check/Adjust tread belt tension (page 22) - Perform speed sensor test (page 21) If speed sensor fails adjust gap, if still fails-replace speed sensor. - Perform belt / deck wear test (page 24) If badly worn, replace belt and deck. - Replace PWM	Note: All trouble shooting should be performed in calibration mode. Page 16
	E3: EPROM Error Software error during treadmill startup	Restart unit- if error persists, replace control panel.	

Symptom	Probable Cause	Corrective Action	Recommended Tools
NO DISPLAY	No power at the 110 VAC outlet.	• Check home circuit breaker. Reset as necessary. • Test for 110 VAC at outlet. • Identify if outlet is a GFI. Note: Some brands of GFI outlets are too sensitive for treadmill use. Call the help line if encountering GFI issues.	Allen Key set. Phillips head screwdriver. Multi-meter.
	No power to the treadmill.	----- • Check for AC light on PWM. (See diagram pages 23-30) • Check for 110 VAC at power cord. Replace if no power. • If Yes- Check for 110 VAC at tread power switch. Replace if no power. • If Yes-Check for 110 VAC at tread circuit breaker. Replace/ reset if necessary. • If Yes- Check for 110 VAC at PWM across AC1 & AC2. • If Yes- Replace PWM.	Note: All trouble shooting should be performed in calibration mode. Page 16
	No power to the control panel.	----- • Check status LED +11 VDC on PWM (See diagram pages 23-30). If not remove fuses and check continuity as replace as needed. • If Yes- Check wire harness connections at PWM and Control Panel. Reconnect as needed. • If Yes- Check voltage on harness at panel. Refer to wiring diagram for your machine type in wiring diagram section. If voltage is present- replace panel and recalibrate (page 16). If voltage is not present check voltage at PWM. If voltage is present at PWM replace pedestal wire harness. If 0 VDC replace PWM and recalibrate (page 16).	


Symptom	Probable Cause	Corrective Action	Recommended Tools
CIRCUIT BREAKER TRIPS	Possible short in treadmill wiring.	• Power off the treadmill and inspect all wiring for shorts or burned areas. • Secure all connectors. -----	Allen Key set Needle nose pliers Socket set Multi-meter
	Motor Issues.	• Disconnect motor leads from the PWM. Power on treadmill, press start. If the breaker does not trip check the motor brushes and perform the motor test procedure (page 22). • Reconnect motor to the PWM, if the breaker trips- replace the motor. -----	
	Incline motor drawing treadmill down	• Unplug incline motor. • Power on treadmill, if breaker does not trip- replace incline motor. -----	
	Bad PWM	• Unplug PWM, power on machine. If breaker <u>doesn't</u> trip- replace PWM. -----	
	Too much tension on belt or obstruction under belt.	• Check for correct tension adjustment (page 22) • Check for obstruction- remove obstruction. -----	
	Weakened circuit breaker or High belt/deck friction	• Perform AC Amp Draw Test (page 20) at circuit breaker. • If draw is less than 15 amps continuously - replace breaker. • Perform Amp Draw test (page 20) If Amp draw is higher than recommended try push test (page 24) procedure.	

Note:
 All trouble shooting should be performed in calibration mode.
 Page 16

Symptom	Probable Cause	Corrective Action
Soft Select Malfunctions	Control Panel Issues	• Enter calibration mode • Is there a count value displayed in the distance window? If No replace control panel. If yes- continue to next step. -----
	Mechanical Issues	• Press and hold the softer button, release. Press and hold the firmer button to detect carriage movement in both directions. If the carriage cannot go full range from -220 and consistently stops in the same place, check for mechanical binding. Inspect the under pan for damage or areas that cause mechanical binding. Also inspect the carriage track in the side frame for binding. If the carriage cannot move to its full range and back in the time limit, check for mechanical binding. • If the carriage is <u>not</u> moving and the motor is turning, check the set screws holding the drive shaft to the motor shaft. -----
	Incorrect/ Missing Count Values	• Threaded shaft turns when commanded but the pulse count does not display/ or does not change. Physically check the hex cam located at the front of the shaft and on the motor shaft. Hex cam should be firmly attached. If hex cam slides freely super glueing it back onto the shaft can repair it. • Hex cam moves but counter does not register. Ensure that the micro switch is properly adjusted and the switch is being made when the hex cam points press against the roller. • Disconnect the cable at J4 and check for continuity on cable. Cable should have continuity if the switch roller is in a flat area of hex cam. If no continuity- replace cable. If good continuity, place cable back on J4 and continue • While in calibration mode place the multi-meter leads on J4 and check for 5 Volts. If no 5 Volts- replace board. -----
	Defective Motor/ Start Capacitor	• If command and count data/voltage are present and Led 1 indicates AC voltage is good but soft select motor does not respond. Set probes on TP 8 and TP3, press soft command (with soft select limit switch not activated) result should be 120 VAC. Set probes on TP8 and TP2 and press firm command (with soft select limit switch not activated) result should be 120 VAC. If no 120 VAC on either test point- replace soft select board. If voltage is correct- continue to next step. • In calibration mode, place red lead on the larger red wire and post on the start capacitor of the soft select system and the black lead on the common black lead, press firm- the result should be 120 VDC. Next place the white lead on the larger white wire and post on the start capacitor of the soft select system and the black lead on the common black lead; press soft- the result should be 120 VDC. If voltage is correct- replace the motor. If voltage is incorrect- replace the start capacitor.

Symptom	Probable Cause	Corrective Action
Soft Select Malfunctions (continued)	AC Power Issues	- Is AC power LED D3 lit? - No- check F1 fuse. If F1 is good check for AC voltage between TP1 and TP5. If fuse and voltage are good- replace the board. -----
	Wire Harness	Yes- While in calibration mode Press the Softer button- LED D1 should light, press the Firmer button- LED D2 should light. If the lights respond to the button then command is being sent from the upper board and received at the soft select board. If lights do not respond check or replace 6-pin data cable, if cable is ok- replace upper panel. -----

**SOFT SELECT BOARD
ILLUSTRATION**

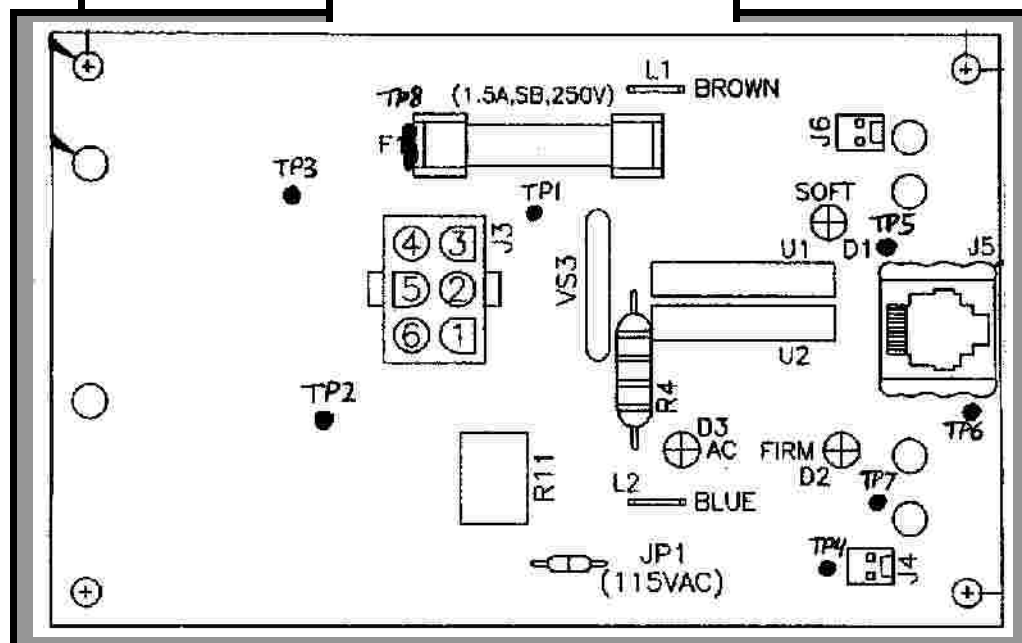

Calibration Procedures

SS 100 PWM (5-xxxxx to 6-79999 serial numbers)

Entering Engineering Mode:

With safety key in, power up unit while holding **Grade Up** and **Grade Down** keys.

Incline will reset to zero.

Mode 1: Max Speed

Press **Select/Enter**- 01 (C1 for 450) appears in Distance.

Adjust speed using **Fast** and **Slow** buttons until 10 or 12 mph

Verify speed by counting belt revolutions: 10mph= 102 Belt revs/per min. 12mph= 121 Belt revs/per min.

Press **Start/Reset** to save max speed, wait for belt to stop.

Mode 2: Speed Table

Press **Select/Enter**-02 (C2 for 450) appears in Distance

Press **Start/Reset** to set speed table. Treadmill will speed up and slow down on its own. Wait for belt to stop.

Mode 3: Incline

Press **Select/Enter**- 03 (C3 for 450) appears in distance

Press **Grade Up** to upper incline limit, then back down slightly

Save upper limit by pressing **Start/Reset**

Turn treadmill off and then back on and check operation

SS90 Calibration (6-8xxxx serial numbers and after)

Enter Calibration Mode by holding the **Up** and **Down** keys while inserting the safety key

In message center window displayed: Press Start to Calibrate

NOTE: In Calibration mode, it is possible to check if the speed sensor is reading all the front roller magnets: the Met light will light when a magnet is in front of the sensor. Speed must be less than 1 mph.

Press **Start/Reset** to begin calibration

Treadmill will elevate and speed up/slow down. Wait for belt to stop.

Message center window will display: Successful, or will indicate error area.

Remove and re-insert safety key. Check operation of treadmill.

DIAGNOSTICS (Available only in SS90 Machines)

To enter diagnostic mode, press and hold the **FAST** and **SLOW** buttons while pushing in the safety key.

The control panel will show "Diagnostics".

Press the **UP** button: Total Hours (in whole hours)

Press the **UP** button: Distance (in miles, two digits past decimal point)

Press the **UP** button: Average Speed (in mph)

Error List (This is an error log, but just a list of errors possible on the unit.)

- S1: Lube
- S2: Clean
- S3: Motor
- S4: Sensor
- E1: Minimum
- E2: Overspeed
- E2: Cal
- E3: EPROM

Remove Safety Key to exit Diagnostics

TEST PROCEDURES

▢ Grounded Outlet Test	Page 20
▢ Amp Draw Test	Page 20
▢ Speed Sensor Test	Page 21
▢ Voltage to Drive Motor Test	Page 21
▢ Drive Motor Test	Page 22
▢ Drive Belt Tension Test	Page 22
▢ Tread belt Tension Test	Page 22
▢ Incline Potentiometer Calibration Test	Page 23
▢ Voltage to Incline Motor Test	Page 23
▢ Belt / Deck Wear Test (Push Off Test)	Page 24

TEST PROCEDURES

GROUNDING OUTLET TEST

This test is very important for optimal HRC and incline operation.

- Set voltmeter for Volts AC
- Place 1 lead in the right side of the outlet (hot)
- Place 1 lead in the ground plug
- A properly grounded outlet will read 110 VAC

AMP DRAW TEST

This test is a good indicator of the wear condition of the belt and deck, and the need for lubrication.

The treadmill circuit breaker will trip at 15 amps, so be sure the voltmeter you are using is rated for at least 15 amps when you are load testing the treadmill. This test can be performed either on one of the AC power cord leads or on one of the DC motor leads from the PWM to the motor. Testing the amp draw at certain speeds without load and with load will signal whether higher than normal amp draw is a result of PWM failure or increased friction from belt and deck wear.

AC AMP DRAW PROCEDURE

This procedure requires an AC clamp-on ammeter. Place the clamp around either of the power cord leads, black or white. Load test requires a person to walk on the tread belt for 5-10 minutes.

2.5 mph w/out load	2.0-2.5 AMPS AC
2.5 mph with load	2.75-3.75 AMPS AC
5.0 mph w/out load	3.5-4.0 AMPS AC
5.0 mph with load	5.0-7.0 AMPS AC

DC AMP DRAW PROCEDURE

This procedure can be performed with an ordinary voltmeter. (**Note: Be sure the voltmeter is rated to handle 15 DC amps.**) Disconnect the red motor lead from MTR1 on the PWM. Connect the voltmeter to MTR 1 on the PWM and the other voltmeter lead to the red motor lead so that the voltmeter completes the connection of the PWM to the motor.

2.5 mph w/out load	4.5-5.0 AMPS DC
2.5 mph with load	7.0-8.0 AMPS DC
5.0 mph w/out load	5.0-5.5 AMPS DC
5.0 mph with load	8.5-9.0 AMPS DC

Higher than normal amp draws without load may signal that belt tension is too tight or there is a problem in the Drive Motor or PWM. Perform the Drive Motor Test and visually check the motor brushes before replacing the PWM. Higher than normal amp draws with load after normal readings without load signal belt and deck friction which may require lubrication or replacement.

TEST PROCEDURES

SPEED SENSOR TEST

This test is used to verify sensor operation in conditions of speed fluctuation, E2: Cal error, S4: Sensor error, E2: Overspeed error or Unsuccessful Calibration.

SS100 (Serial numbers 5-xxxx to 6-7999)

Set voltmeter to Volts DC. Treadmill power on speed and speed at 0mph

Attach voltmeter leads across outside 2 contacts at P2 on PWM

With magnet in front of sensor, 0 VDC

With no magnet in front of sensor, 3.0 VDC

SS90 (Serial numbers 6-8000 and above)

Set voltmeter to volts DC. Treadmill power on and speed at 0 mph

Attach voltmeter leads across outside 2 contacts at J1 on PWM

With magnet in front of sensor, 0 VDC

With no magnet in front of sensor, 5 VDC

Check the sensor on every magnet, adjust sensor until voltage shows

In calibration mode before pressing Start, the tread belt can be moved manually and the Met light will blink when a magnet is in front of the sensor.

VOLTAGE TO DRIVE MOTOR TEST

This test is used to diagnose conditions of NO Belt Movement, or Speed Fluctuations

Set voltmeter to volts DC and adjust speed on Control Panel to 4 mph

Attach red voltmeter lead to MTR1 on PWM with motor wires attached

Attach black voltmeter lead to MTR2 on PWM with motor wires attached

0 VDC signals no PWM output

166 VDC signals open circuit in motor or motor connection

Operating voltage will lay between 0 VDC and 166 VDC

NOTE: The reason that we do not narrow down PWM output voltage is that the PWM output is a pulse signal. The sampling rate of the voltmeter used will determine what output voltage the voltmeter is able to read.

TEST PROCEDURES

DRIVE MOTOR TEST

This test is used in conditions of No Belt Movement.

- Unplug treadmill and set voltmeter to volts DC
- Disconnect motor leads from PWM
- Place 1 voltmeter lead in each motor wire
- Gently spin the motor flywheel and check for voltage DC
- 2-5 VDC means normal motor operation
- 0 VDC means motor malfunction

DRIVE BELT TENSION TEST

This test is used in front roller replacement and in conditions of belt slipping.

- Place two fingers on top of the drive belt halfway between the front roller pulley and the drive motor pulley.
- With moderate pressure push down on belt
- If belt deflects down more than 1/8 ", tighten motor mounts
- If belt deflects down less than 1/8 ", loosen motor mounts.
- It is also possible to twist the belt; you should be able to twist the belt almost to a vertical position

TREADBELT TENSION TEST

This test will address belt slipping and is used in any roller replacement or deck replacement. Ensure that the drive belt is properly tensioned before adjusting tread belt tension. Belt and deck wear and/or lack of lubrication can cause the tread belt to show symptoms similar to loose tread belt tension- check these conditions before adjusting tread belt tension.

- Turn treadmill on and adjust speed to 2 mph
- Walk heavily on the belt pulling slightly against belt movement
- If hesitation or slip is detected, tighten tread belt tension bolts ¼ turn
- Repeat until no hesitation or slip is encountered. Check at higher speeds

Tread belt tension is too tight if the belt feels stiff to touch with no give or the belt groans against the rollers. You should be able to insert your hand between the belt and deck palm up almost to your thumb when the belt is at proper tension.

TEST PROCEDURES

INCLINE POTENTIOMETER CALIBRATION TEST

This test can correct E1: Minimum conditions and aid in diagnosis of incline problems with finding zero or target incline.

SS100 and SS90

Set voltmeter to Ohms (Ω) with treadmill unplugged from wall

Place 1 voltmeter lead on pin 3 (Blue) and 1 lead on pin 2 (Orange)

Check for 800 Ohms

SS90 Only: In calibration mode before pressing Start, the Distance window displays the incline number.

With the treadmill at zero, the number should be between 160 and 180. 0 often indicates a wire harness misconnection or failure of signal to panel.

As the unit inclines during calibration, watch the numbers in the Distance window, if they do not increase by at least 60 from the zero value, an E1: Minimum error will result. Then the zero value may need to be reset to a lower value.

If incline potentiometer needs adjustment, remove swivel opines and twist incline motor shaft by hand for SS100 or use Up and Down keys for SS90. (See diagram on T-6)

VOLTAGE TO INCLINE MOTOR TEST

This test is utilized in conditions of No Incline Movement, Incline Fluctuation, or E1: Minimum.

Set voltmeter to AC volts. To access incline plug, PWM screws may need to be removed.

Place voltmeter leads across White and Black while pushing UP button

10 VAC indicates normal PWM output, 0 VAC signals no output

Place voltmeter leads across Red and White while pushing Down button

110 VAC indicates normal PWM output, 0 VAC signals no output

TEST PROCEDURES

Belt / Deck Wear Test

This is a simple physical test to gauge the general level of friction present between the deck and belt.

1. While the treadmill is not running, inspect the condition of the underside of the tread belt. The fabric should be soft and porous. If the belt appears glazed- replace the belt.
2. While the treadmill is not running, slide your hand under the belt and feel the surface of the deck. The deck should feel smooth with no abrasions or scratches. If any abrasions or scratches are found- replace the deck.

Push Off Test


Place the machine in Calibration mode, elevate to the highest elevation- speed should be set to 0. Stand on the tread belt positioning yourself close to the console; push off with moderate force. The elevation combined with your weight and the force of the push should cause the belt to carry you all the way to the end of the machine*. If the test does not carry you to the end of the machine lubricate the belt using True Fitness liquid silicone. After lubricating the belt/deck perform the push off test again. If it does not pass the test after lubricating replace the belt and deck

*** Note:** Residential treadmills may only carry about ¾ of the distance of the deck due to higher tension on the belt.


WIRING DIAGRAMS

▢ 350 Gray	Page 26
▢ 350 Black	Page 27
┘ 400	Page 28
▢ 450/500/700	Page 29
▢ 500CI/750CI	Page 30
┘ 750 NON/P	Page 31
▢ 750	Page 32


350 Gray Wiring Diagram

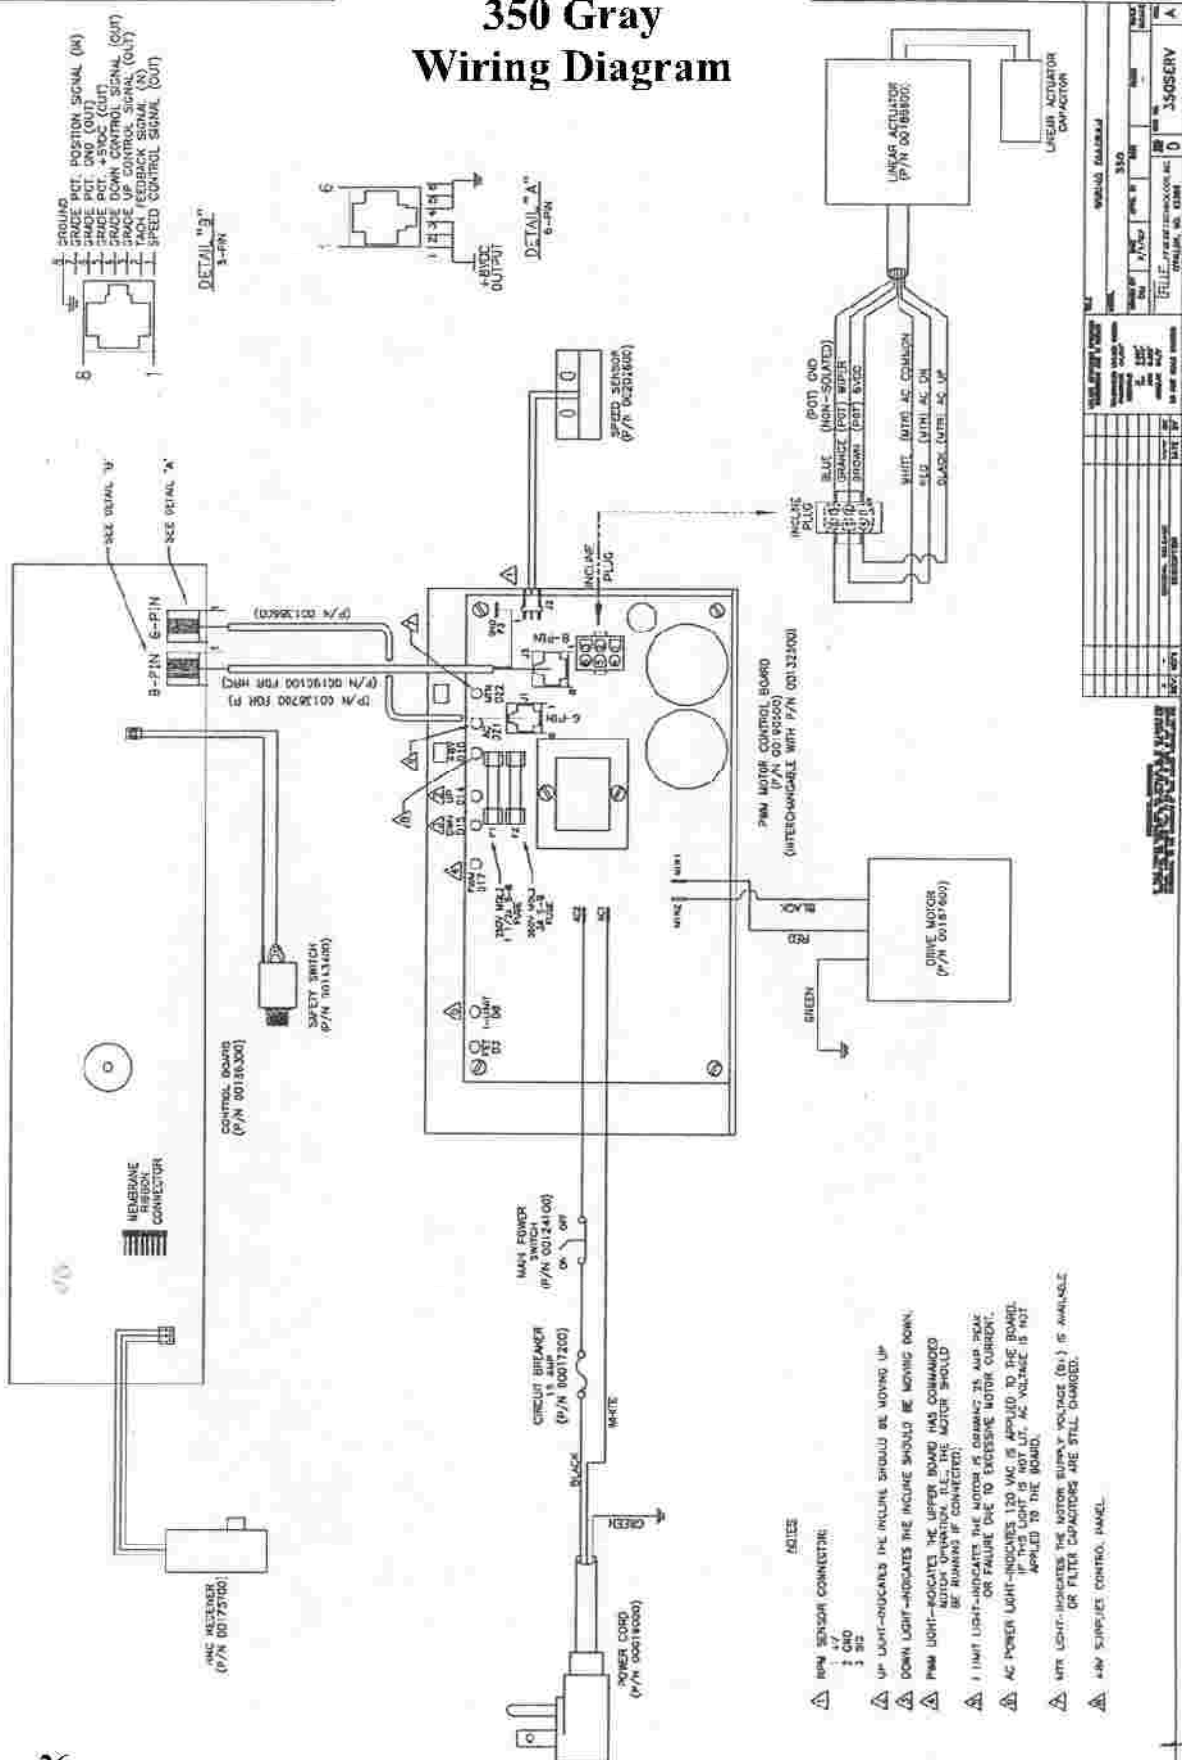


350 Black Wiring Diagram

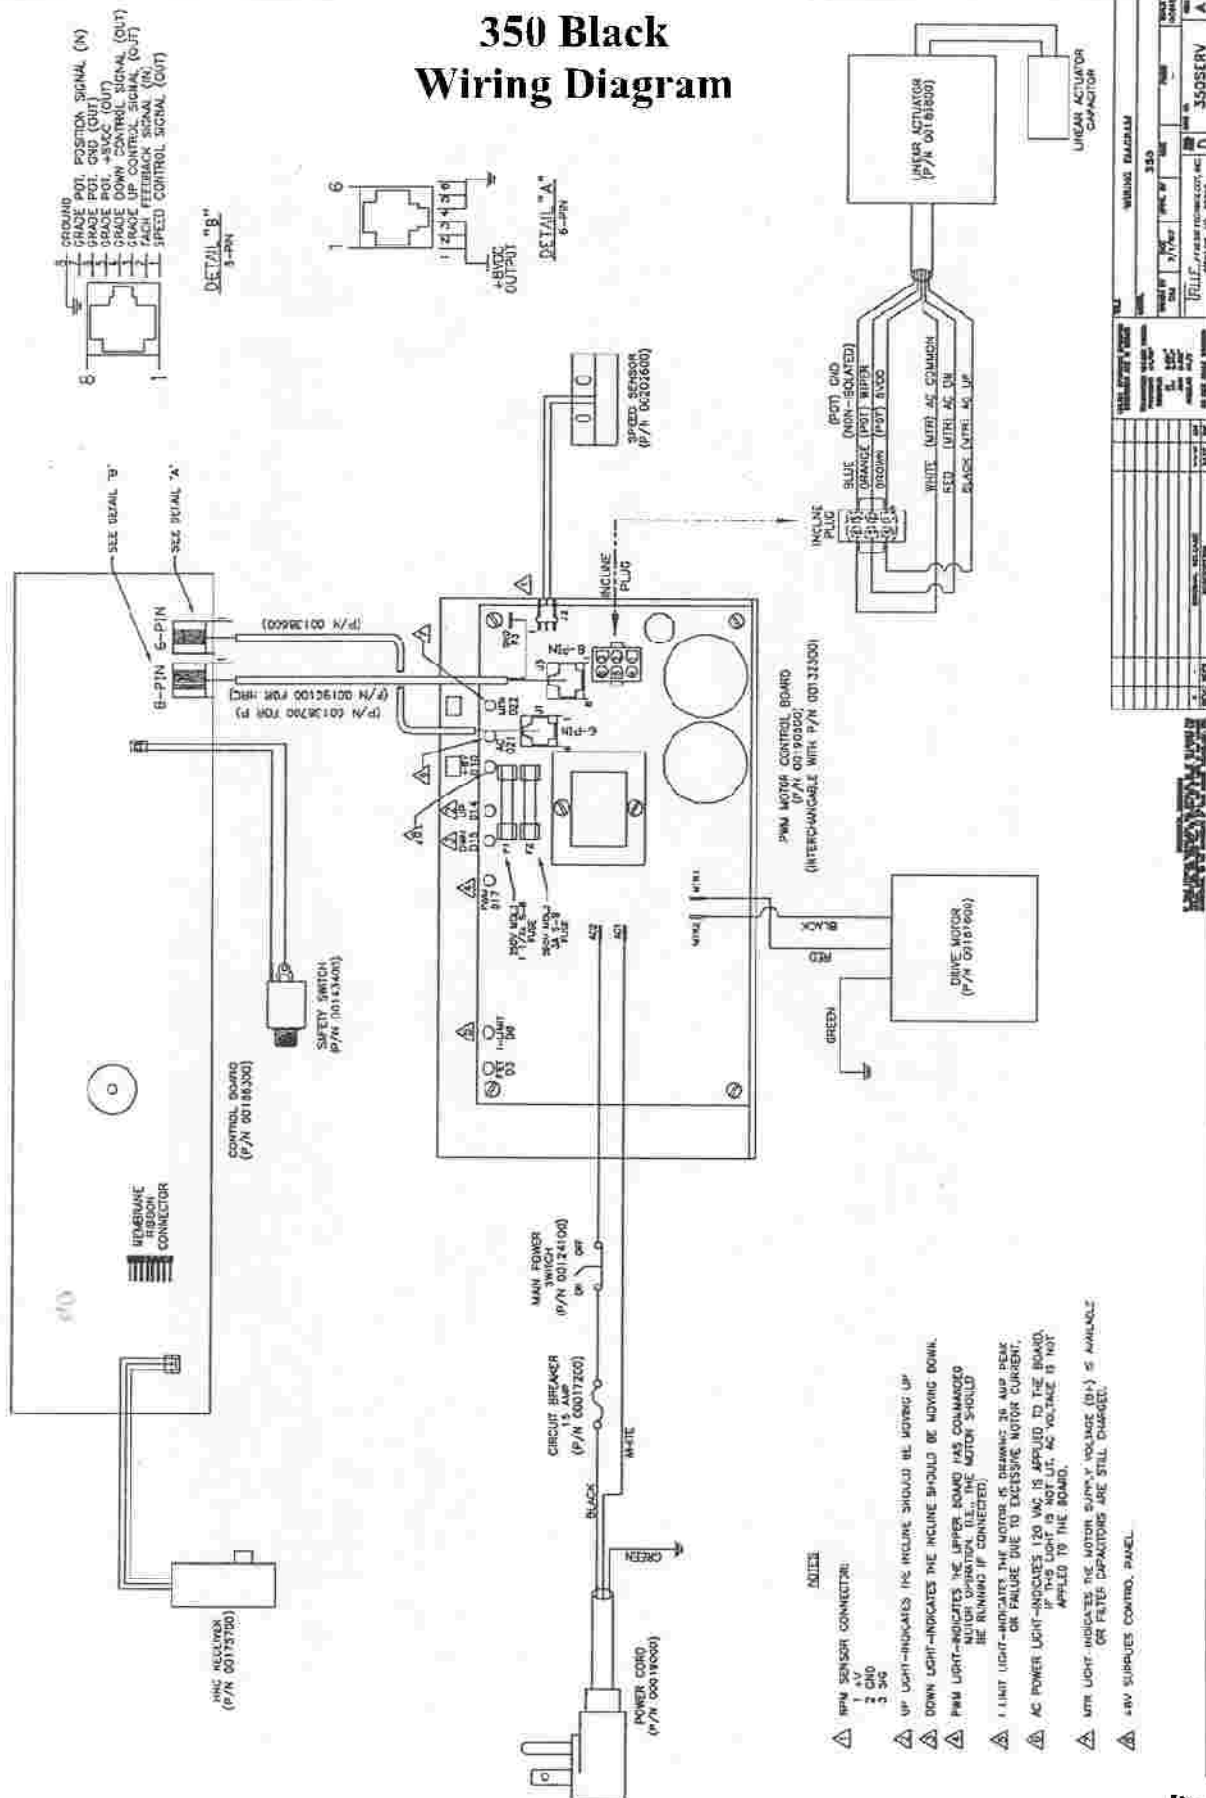

400 Wiring Diagram

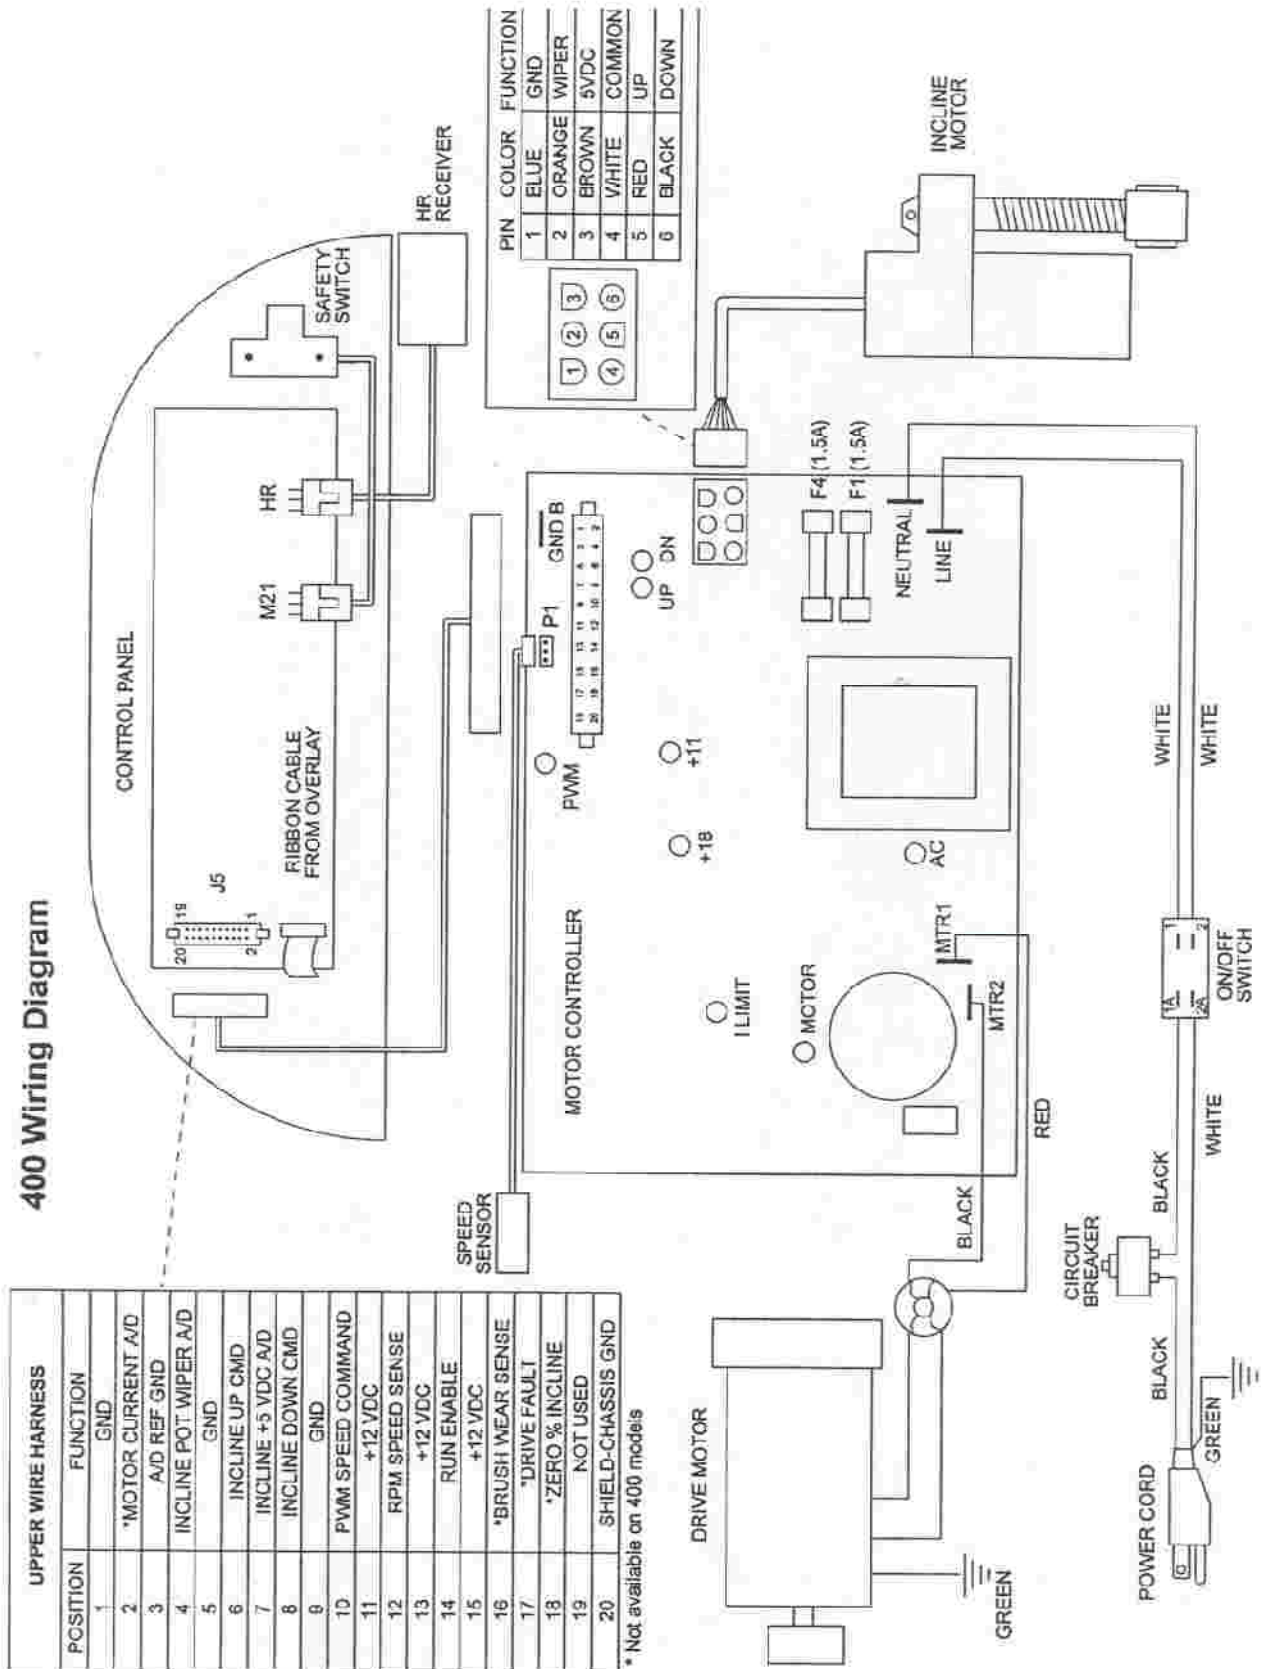

450/500/700 Wiring Diagram

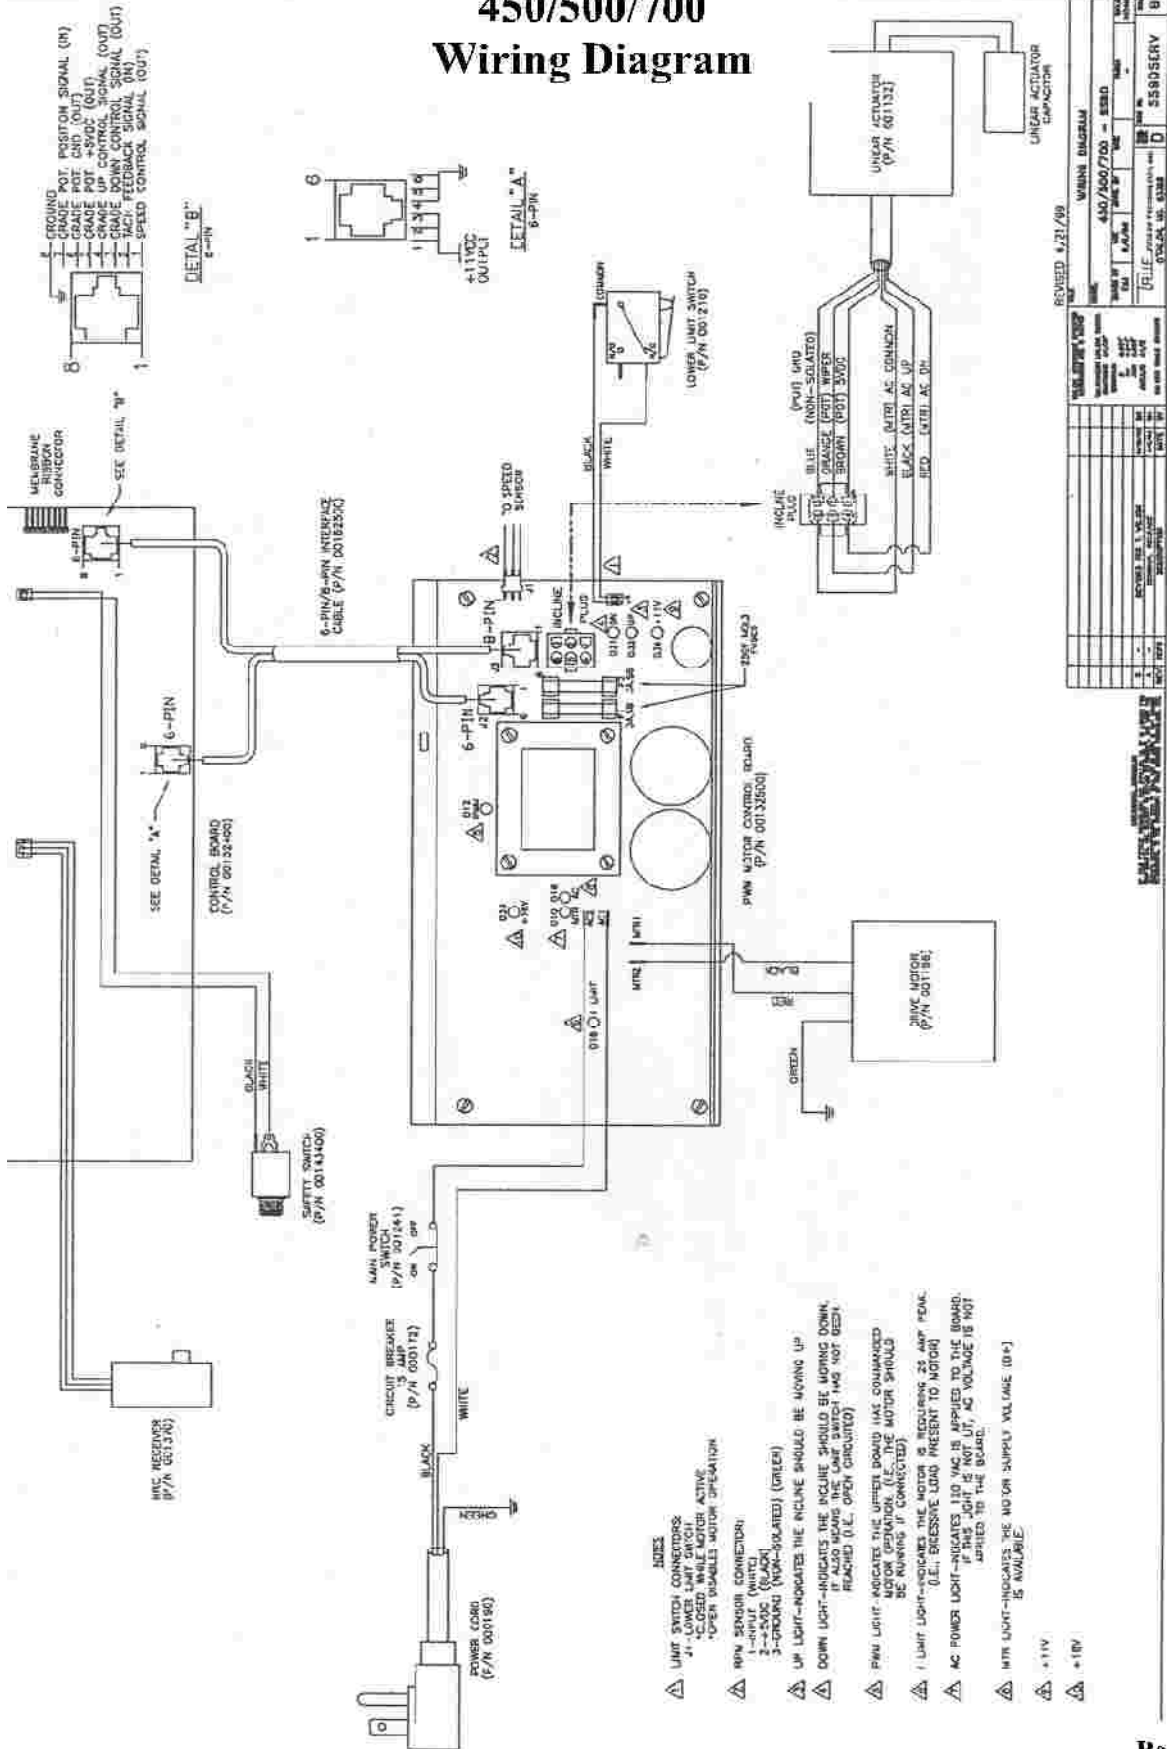

© 2006 The Authors
Journal compilation © 2006 Blackwell Publishing Ltd





750



Model 350-450

Parts List

- ▣ **350, P, HRC** **Page 34**
- ▣ **350PB, HRCB** **Page 37**
- ▣ **400, P, HRC** **Page 39**
- ▣ **450, P, HRC (SS100-SS90)** **Page 41**

350P, HRC PARTS LIST

<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>	
<u>350 Board Only</u>	70186311 350 P Board Only
<u>(98- Present)</u>	70186310 350 HRC Board Only
<u>(98-PRESENT)</u>	70186401 350P CONTROL PANEL 98-now
	70186402 350HRC CONTROL PANEL 98-NOW
<u>(HARDWARE)</u>	70185400 HRC RECEIVER ASSY.
	70161900 5/8" DOME PLUG FOR HR RECEIVER
	70176000 C.P. TAPE 3/8 DOUBLE COATED FOAM
	70150000 SAFETY SWITCH ASSY.
	70177400 SAFETY KEY ASSY.
<u>OVERLAYS</u>	
	70186411 350P GRAY OVERLAY
	70186412 350HRC GRAY OVERLAY
<u>PWM</u>	
	LOWER BOARD (PWM)
	70013600 PWM SCREW 10-32 X 3/8 PPHTF
	70350300
<u>SPEED SENSOR</u>	
	70202600 SPEED SENSOR
	70360300 EXTENDER WIRE FROM SENSOR -PWM
	70190800 SPEED SENSOR SCREW
<u>DATA CABLE</u>	
	70138600 6- CONDUCTOR INTERFACE CABLE
	70138700 8- CONDUCTOR INTERFACE CABLE
	70190100 8- CONDUCTOR INTERFACE CABLE- HRC
<u>DRV MTR</u>	
	70187600 DRIVE MOTOR ASSY.
	70166600 MOTOR DRIVE PULLEY
	70173400 MOTOR COVER
<u>DRV BELT</u>	
	70127500 POLY-V-BELT
<u>ELEVATION MTR</u>	
	70186800 INCLINE MOTOR
	70183600 CLEVIS PIN 3/8 X 1 3/4
	70116700 COTTER PIN 1/16 X 1 5/16
	70183700 CLEVIS PIN 3/8 X 2 1/8
	70164800 COTTER PIN 3/32 X 1/2
	70183200 INCLINE CAPACITOR

ELEVATION RACK

70184401 ELEVATION RISER ASSY.
70176700 MOLDED WHEEL
70182300 INCLINE RISER BOLT 5/16- 18 X 1 1/4
70115200 INCLINE RISER WASHER 3.8 I.D. X 7/8 O.D.
70209900 INCLINE RISER NUT 5/16- 18 AUTOMATION GR.

POWER CORD

70253100 9FT. POWER CORD
70008200 STRAIN RELIEF BUSHING

ON / OFF SWITCH

70251100 ROCKER ON/OFF SWITCH

CIRCUIT BREAKER

70017200 15 AMP CIRCUIT BREAKER

TREADBELT

70208500 TREADBELT 18" X 107"

DECK

70186700 FLEX DECK ASSY.
70020200 DECKSCREWS/BUMPER FEET 10- 32 X 1 1/4 PPH

FRONT ROLLER

70217500 FRONT ROLLER ASSY.
70188500 FR ROLLER BOLT 1/4- 20 X 2 Gr. 5 Hex Hd.
70185300 FR ROLLER NUT 1/4- 20 NYLOC NUT

REAR ROLLER

70188000 REAR ROLLER ASSY.
70175100 REAR ROLLER COVER-LEFT
70175200 REAR ROLLER COVER-RIGHT
70104000 R ROLLER SCREW 10 X 1/2 PPH Tek Screw

STRADDLE COVERS

70173301 STRADDLE COVER- L.H. 350P
70173302 STRADDLE COVER- R.H. 350P

70173303 STRADDLE COVER- L.H. 350 HRC
70173304 STRADDLE COVER- R.H. 350 HRC

70086700 STRADDLE COVER SCREW 6 X 1
70182400 INSIDE COVER SPACER
70030900 3/8 X 1/16 X Lg. DOUBLE STICK TAPE
70165400 OUTSIDE COVER SPACER

RAMRAILS

70188700 HANDRAIL ASSY. L.H. BLACK
70188800 HANDRAIL ASSY. R.H. BLACK

70212300 HANDRAIL ASSY. L.H. GRAY

70212400 HANRAIL ASSY. R.H. GRAY

70185100 LOWER HANDRAIL BUSHING 1/4- 20 X 3 3/4

70198900 LOWER HANDRAIL BUSHING 3/8 OD X 1"

70183101 H/BAR NUT PLATE

PEDESTAL

70157000 PED. STAR WASHER 1/4 I.D.INTERNAL TOOTH WASHER

70186600 PEDESTAL WELDMENT

70179901 STRAP CLAMP PED.

70155900 PED. SCREW 1/4- 20 X 5/8 BHSCS

FRAME

70181901 FRAME WELDMENT

70160100 BUMPER ASSY

70155200 BUMPER- 1 1/2 X 2 X 1 1/8

350PB, HRCB PARTS LIST

<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>	
<u>(350B) Board Only</u>	
70237311	350PB Board Only
70237310	350HRCB Board Only
70242000	350PB CONTROL PANEL
70242001	350HRCB CONTROL PANEL
70150000	SAFETY SWITCH ASSY.
70185400	HEART RATE RECIEVER
70245100	PLASTIC HRC COVER
70177400	SAFETY KEY
<u>OVERLAY</u>	
70242010	350PB DOT/OVERLAY
70242011	350HRCB DOT/OVERLAY
<u>PWM</u>	
<u>(99-PRESENT)</u>	
70244200	PWM MOTOR CONTROLLER
70013500	PWM SCREW 10-32X3/8
<u>SPEED SENSOR</u>	
70243203	CIRCUIT BOARD SPEED SENSOR
70243300	SPEED SENSOR SCREW 4-40X1/4
<u>DATA CABLE</u>	
70264100	6COND./CORD DATA CABLE 350PB, HRCB
70264000	8COND./CORD DATA CABLE 350PB
70190100	8-CONDUCTOR INTERFACE CABLE(HRC)
<u>DRV MTR</u>	
70245600	DRIVE MOTOR Core charge included
<u>DRV BELT</u>	
70127500	1687J10 POLY-V-BELT
<u>ELEVATION MTR</u>	
<u>(HARDWARE)</u>	
70186800	ELEVATION MOTOR-HUBBLE
70183200	ELEVATION MOTOR CAPACITOR
70183600	INCLINE MOTOR CLEVIS PINS 3/8X1 3/4
70116700	INCLINE MOTOR COTTER PIN 1/16X1-5/16
70183700	INCLINE MOTOR CLEVIS PIN 3/8X2-1/8
70164800	INCLINE MOTOR COTTER PIN 3/32X1/2
<u>ELEVATION RACK</u>	
70184402	ELEVATION RACK

(NEW STYLE)

70176700	MOLDED WHEEL
70182300	INCLINE RISER BOLT 5/16X1 1/4
70115200	INCLINE RISER WASHER 3/8 I.D.
70209900	INCLINE RISER NUT 5/16-18

POWER CORD

70253100	9 FOOT POWER CORD
70008200	STRAIN RELIEF BUSHING

ON / OFF SWITCH

70251100	ON/OFF ROCKER SWITCH
----------	----------------------

CIRCUIT BREAKER

70017200	15 AMP CIRCUIT BREAKER
----------	------------------------

TREADBELT

70208500	TREADBELT 18" X 107"
----------	----------------------

DECK

70186700	FLEX DECK
70020200	DECK SCREWS
70232700	DECK BUMPERS

FRONT ROLLER**(ADJUSTABLE)**

70260100	FRONT ROLLER W/8 MAGNETS
70188500	FRONT ROLLER BOLT 1/4-20X2 GR. 5
70185300	FRONT ROLLER NYLOK NUT 1/4-20

REAR ROLLER

70188000	REAR ROLLER
70220800	REAR ROLLER COVER LH BLACK
70220900	REAR ROLLER COVER RH BLACK
70104000	10X1/2 REAR ROLLER SCREW

STRADDLE COVERS

70173305	LH STRADDLE COVER BLACK
70173306	RH STRADDLE COVER BLACK
70086700	STRADDLE COVER SCREW 6X1
70030900	DOUBLE SIDED STICK TAPE

PEDESTAL

70157000	PEDESTAL STAR WASHER
70173401	MOTOR COVER
70155200	BUMPER FEET
70020200	BUMPER FEET SCREWS
70183101	H/BAR NUT PLATE

400P, HRC PARTS LIST

Control Panels

7T007500	400P Control Panel assy w/ Electronics
7T007501	400HRC Control Panel assy w/ Electronics
7T007502	400P Electronics Only
7T007503	400HRC Electronics Only
7T008000	Upper Plastic Front and Rear (400HRC)
7T008001	Upper Plastic Front and Rear (400P)

Overlays

7T010201	Panel Overlay 400P
7T010200	Panel Overlay 400HRC
7T014200	Panel Overlay T-400HRC

PWM

7T007400	PWM W/O Hardware
7T008500	Speed sensor
7T013900	PWM W/O Hardware (230V)

Filter

7T014800	Filter, EMI 400 250V/10A CP6-1022C
7T014000	Bracket, Filter 400 (T=2.0)
7T014100	Bracket Screw Phillips Head M5X0.8X6L UCP

Choke

7T014400	Choke, 400 3MH 220V
----------	---------------------

Inductor

7T014900	Inductor (choke) 400 6MH 8A
----------	-----------------------------

Data Cable

7T007600	Wire Harness
----------	--------------

Drive Motor

7T007800	2.75 HP Drive Motor
7T014300	2.75 HP Drive Motor 230V

Drive Belt

7T008400	Drive Belt
----------	------------

Elevation Motor

7T009600	Elevation Motor
7T009700	Front Wheel
7T014500	Elevation Motor 230V 1/6HP

Power Cord

7T009800	Power Cord
----------	------------

	7T014600	Power Cord 400 AC220V 1.5MM 2800MM
<u>On/Off Switch</u>	7T009900	On/Off Switch
<u>Circuit Breaker</u>	7T010000	Circuit Breaker
	7T014700	Circuit Breaker 400 10A 220V 400RFMB Series
<u>Tread belt</u>	7T008300	Tread belt
<u>Deck</u>	7T008600	Deck, pre drilled
<u>Front Roller</u>	7T008100	Front Roller
<u>Rear Roller</u>	7T008200	Rear Roller
	7T009200	Roller Cover - L
	7T009300	Roller Cover - R
<u>Straddle Covers</u>	7T009500	Straddle Cover Set
<u>Hardware Kit</u>	7T007900	Complete Hardware Kit
<u>Heart Rate Strap</u>	7TMC0608006	HRC Strap
<u>Safety Key</u>	7T010300	Safety Key

450P, HRC (SS100-SS90) PARTS LIST

<u>CONTROL PANEL</u>	<u>PART #</u>	<u>DESCRIPTION</u>
<u>(SS100)</u>	70120000	450NON SS100CONTROL PANEL
	70120100	450P SS100 CONTROL PANEL
	70175900	450HRC SS100 CONTROL PANEL
<u>(450's) Board Only</u>	70132418	450NON SS90 CONTROL Board Only 97-98
	70132417	450P SS90 CONTROL Board Only 97-98
	70132416	450HRC SS90 CONTROL Board Only 97-98
<u>(97-98 STYLE)</u> <u>(OVERLAYS)</u>	70161011	450NON SS90 OVERLAY 97-98
	70161013	450P SS90 OVERLAY 97-98
	70161012	450HRC SS90 OVERLAY 97-98
<u>(99-PRESENT)</u>	70242110	450NON DOT OVERLAY 99-PRESENT
	70242111	450P DOT OVERLAY 99-PRESENT
	70242112	450HRC DOT OVERLAY 99-PRESENT
<u>PWM</u> <u>(SS100)</u>	70113900	MOTOR CONTROLLER (SS100)
<u>(SS90)</u>	70132500	MOTOR CONTROLLER SS90
	70013500	PWM SCREW 10-32 X 3/8
<u>SPEED SENSOR</u> <u>(SS100 STYLE)</u>	70104200	SPEED SENSOR (SS100)
	70154800	SPEED SENSOR W/ WIRE AND BRACKE
<u>(SS90 STYLE)</u>	70243200	CIRCUIT BOARD SPEED SENSOR
	70243300	SP. SENSOR SCREW 4-40 X 1/4
<u>DATA CABLE</u>	70337900	450NON AND PROG. DATA CABLE
	70337800	450 HRC DATA CABLE
<u>DRV MTR</u>	70325500	3HP DRIVE MOTOR 10 MPH
<u>DRV BELT</u>	70006300	210J10 POLY-V DRIVE BELT
<u>ELEVATION MTR</u>	70113200	INCLINE MOTOR
<u>(ELEVATION- HARDWARE)</u>	70115500	3/8 X 1 1/2 CLEVIS PIN
	70116700	1/16 DIA. X 1 5/16 COTTER PIN

	70118000	TORQUE ARM SWIVEL PIN
	70183200	START CAPACITOR FOR INCLINE MOTOR
	70013500	SCREW FOR START CAPACITOR
<u>LLS</u>		
	70121000	LOWER LIMIT SWITCH
	70125700	LLS SCREW 10X 1/4
	70120500	LLS TO PWM WIRE
<u>ELEVATION RACK</u>		
	70281001	ELEVATION RISER SUB ASSY.
<u>WHEEL</u>	70176700	BEFORE AUG 99
<u>POWER CORD</u>		
	70253100	Ø FT. POWER CORD
	70008200	STRAIN RELIEF BUSHING
<u>ON / OFF SWITCH</u>		
	70251100	ROCKER ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	15 AMP CIRCUIT BREAKER SWITCH
<u>TREADBELT</u>		
	70159300	17 3/4" X 107 3/4" 2 PLY TREADBELT
<u>DECK</u>		
	70157700	FLEX DECK
	70020200	DECK SCREW 10/32 X 1 1/4
<u>FRONT ROLLER</u>		
<u>(SS100-NARROW)</u>	70123800	FRONT ROLLER (SS100)
<u>(95-xxxx - 99)</u>	70217000	450 FRONT ROLLER(6-8XXXX-99)
<u>(99-81023G TO)</u>	70359200	450 ADJ. ROLLER
<u>(PRESENT)</u>		
<u>REAR ROLLER</u>		
	70359000	REAR ROLLER
	70158900	ROLLER BOLT
	70159000	5/16 INTERNAL TOOTH LOCK WASHER
<u>STRADDLE COVERS</u>		
	70162000	LT & RT STRADDLE COVERS
	70030900	3/8 X 1/16 X 108 FT. DBL. STICK TAPE
	70243400	BLUE TAPE 1/2 X 150 FT. ROLL
<u>PEDESTAL</u>		
<u>(98 style)</u>	70176800	Pedestal Weldment, 450 W/ end caps
<u>(99- 00 style)</u>	70233200	ROUND PEDESTAL WELDMENT
	70155900	PEDESTAL SCREWS
<u>FRAME</u>		
	70255903	FRAME WELDMENT ADJ. FRONT ROLLER
	70155200	BUMPER FEET
	70020200	BUMPER FEET SCREW 10/32X1 1/4PPH

Model 500-550

Parts List

▫ 500, P, HRC (SS100-SS90)	Page 44
▫ 500Z & ZT, P, HRC	Page 48
▫ 540, P, HRC, CI (NON Z)	Page 51
▫ 540Z, ZT, P, HRC, CI	Page 54
▫ 550, P, HRC	Page 57
▫ 550z, P, HRC, CI	Page 59
▫ 550 ZTX, P, HRC, CI	Page 61

500P, HRC (SS100-SS90) PARTS LIST

	<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>		
<u>500 Boards Only (SS90)</u> <u>Up to 98 with a letter</u>	70132415	500NON Board Only
	70132414	500P Board Only
	70132413	500HRC Board Only
	70178911	500CI Board Only
<u>500 (99 Style Board Only)</u> <u>(98 with a letter)</u>	70237523	500P Board Only
	70237522	500HRC Board Only
	70237812	500CI Board Only
<u>500A (2000) Style Board Only</u>	70237415	500A NON Board Only
	70237414	500A P Board Only
	70237413	500A HRC Board Only
	70018100	CHERRY SWITCH (SS100)
	70150000	SAFETY SWITCH-ASSY
	70177400	SAFETY KEY
	70020400	SAFETY SWITCH SCREWS
	70020500	SAFETY SWITCH NUTS
	70185400	HEART RATE RECEIVER
	70138500	POLAR HEART RATE CHEST STRAP
	70284100	Old 500
	70240503	EXTRUSION-PANEL CLIP 26 3/4"
<u>OVERLAY</u>		
<u>(SS100 OVERLAY)</u>	70119301	500 NON OVERLAYS-SS100
	70119901	500P OVERLAYS-SS100
	70179701	500 HRC OVERLAYS-SS100
<u>(98 OVERLAY)</u>	70160811	500 NON SS90 OVERLAY 98 STYLE
	70160813	500 P SS90 OVERLAY 98 STYLE
	70160812	500 HRC SS90 OVERLAY 98 STYLE
<u>(99 OVERLAY)</u> <u>(98 with a letter)</u>	70242211	DOT/OVERLAY ASSY, 500P
	70242212	DOT/OVERLAY ASSY, 500HRC
<u>(2000 STYLE)</u>	70265100	DOT / OVERLAY ASSY, 500A
	70265011	DOT / OVERLAY ASSY, 500A HRC
	70265012	DOT / OVERLAY ASSY, 500A P
	70242410	DOT / OVERLAY ASSY, 500CI
<u>PWM</u>		
<u>(SS100)</u>	70113900	PWM MOTOR CONTROLLER-SS100
	70132500	SS90 PWM MOTOR CONTROLLER

<u>SPEED SENSOR</u>	70183500	500CI PWM [96-80000]-[98-80000]SS95
	70154800	SPEED SENSOR ASSY.-SS100
	70243200	SS90 SPEED SENSOR NEW STYLE
<u>DATA CABLE</u> (SS100)	70119400	DATA CABLE-SS100 NON, P, HRC
	70120400	LOWER WIRE HARNESS-SS100
	70337900	INTF. CABLE ASSY 500 N/P SS90
	70337800	INTF. CABLE ASSY 500 HRC SS90
<u>DRV MTR</u> (SS100)	70155101	DRIVE MOTOR-2.0 10MPH
	70155102	DRIVE MOTOR-2.5 12MPH
	70325500	DRIVE MOTOR 3HP SS90-Z SERIES
	70125600	DRIVE MOTOR-CARRIAGE BOLT
<u>DRV BELT</u>	70006300	DRIVE BELT 210J10-V BELT
<u>ELEVATION MTR</u>	70113200	ELEVATION MOTOR
	70118900	SWIVEL PIN
	70183200	INCLINE START CAPACITOR
	70115500	CLEVIS PIN 3/8 DIA. 1 1/2" LONG
	70116700	COTTER HAIR PIN .062 DIA.
	70022600	SET SCREW, INCLINE, SWIVEL PIN
<u>LLS</u>	70121000	LOWER LIMIT SWITCH
	70120500	WIRE-PWM TO LOWER LIMIT SWITCH
<u>ELEVATION RACK</u>	70281002	ELEVATION RACK
	70154600	INCLINE BEARING BLOCK
	70126200	FLANGED INCLINE BEARING
<u>WHEEL / BOLTS</u>	70176700	MOLDED WHEEL, 2 1/4" DIA. 3/8 HOLE
	70003100	SHOULDER BOLT-FRONT WHEEL 3/8 X 1"
<u>(NEW STYLE)</u>	70176701	MOLDED WHEEL, 2 1/4" DIA 1/2" HOLE
	70174300	1/2" X 1" SHOULDER BOLT
<u>POWER CORD</u>	70253100	POWER CORD, 120 VAC
	70013900	BUSHING-3/8"BLACK
	70008200	STRAIN RELIEF BUSHING

ON / OFF SWITCH

70251100	ON/OFF SWITCH
70261000	220V ON/OFF SWITCH

CIRCUIT BREAKER

70017200	15 AMP CIRCUIT BREAKER
----------	------------------------

TREADBELT

70159400	TREADBELT
70058100	STRETCH-TREADBELT
70058200	ORTHO-TREADBELT-20X108 ROL-TOP
70068500	ORTHO-STRETCH TREADBELT

DECK**(SS100)**

70072800	DECK ASSY
70072700	STRETCH DECK ASSY
70157900	FLEX DECK ASSY. 500/WELDED
70157800	STRETCH DECK ASSY, 500S/WELDED

(DECK HARDWARE)

70232700	DECK BUMPER-ASSY.
70086700	DECK BUMPER SCREWS
70020200	DECK SCREW 10-32 X 1 1/4"

FRONT ROLLER**(SS100)**

70119500	FRONT ROLLER-95 WIDE WITH 4 MAG.
70207800	ROLLER SCREW

70217300	FRONT ROLLER ASSY, '99
----------	------------------------

97

HARDWARE - ADJ.

70255400	FRONT ROLLER ASSY, ADJ. '00
70188500	BOLT 1/4-20 / ADJ. END
70185300	NUT 1/4-20
70256800	FLAT WASHER
70190900	FLANG BOLT 1/4-20 FIXED END

REAR ROLLER**(SS100)**

70073600	REAR ROLLER ASSY SS100
70157400	REAR ROLLER ASSY, WELDED SS90

STRADDLE COVERS**(SS100)**

70074700	STRADDLE COVER-RIGHT SIDE
70074900	STRADDLE COVER-LEFT SIDE
70162101	STRADDLE COVER ALM. '99 STYLE
70162102	STRETCH STRDL. CVR. ALM. '99 STYLE

70263900	STRADDLE COVER PLASTIC 500A,P,HRC
----------	-----------------------------------

PEDESTAL
(SS100)

70122200	PEDESTAL ASSEMBLY-VINYL
70070200	HANDLEBAR
70155900	PEDESTAL SCREW
70013500	HANDLEBAR SCREWS #10-32X3/8

('98 STYLE)

70179500	PED.-WELDMENT 500NON,P,HRC '98
70179500	PED.-WELDMENT 500CI '98

('99-'00 / '98 W/LETTER)

70233300	PED.-WELDMENT 500 NON,P,HRC '99-'00
70233400	PED.-WELDMENT 500CI '99-'00
70204200	RAM RAILS NON CHR

FRAME

70155200	BUMPER FEET
----------	-------------

LUBRICATION

70348900	LUBE STICK
70349000	SILICONE PACKET (1 APPLICATION)

70204200	RAM RAILS NON CHR
----------	-------------------

FRAME

70155200	BUMPER FEET
----------	-------------

LUBRICATION

70348900	LUBE STICK
70349000	SILICONE PACKET (1 APPLICATION)

500Z & ZT, P, HRC PARTS LIST

<u>CONTROL PANEL</u>	<u>PART #</u>	<u>DESCRIPTION</u>
<u>(500ZT's) Overlay Only</u>	70327510	500ZT NON/P Overlay Only
<u>Z also</u>	70327511	500ZT HRC Overlay Only
 <u>(500ZT'S) BOARDS</u>	70328016	500ZT NON CONTROL BOARD ONLY
<u>ONLY</u>	70328015	500ZT P CONTROL BOARD ONLY
	70328014	500ZT HRC CONTROL BOARD ONLY
 <u>(500ZT EX'S) BOARDS</u>	70328056	500ZTEX NON CONTROL BOARD ONLY
<u>ONLY International</u>	70328055	500ZTP EX CONTROL BOARD ONLY
	70328054	500ZTHRC EX CONTROL BOARD ONLY
 <u>SAME PANELS</u>	70328100	500Z,ZT NON PANEL
<u>AS NEW 500ZT</u>	70328101	500Z,ZT P PANEL
<u>SERIES.</u>	70328200	500Z,ZT HRC PANEL
	70290601	PANEL, BOTTOM CONSOLE
	70294301	PANEL LF.LWR. GRIP CLOSURE
	70290801	PANEL RT.LWR. GRIP CLOSURE
	70290701	HANDLE LT. CONSOLE
	70290801	HANDLE RT. CONSOLE
	70331000	MAGNET SAFETY KEY
 <u>PWM</u>		
	70132500	PWM - MOTOR CONTROLLER
 <u>500 ZT SERIES</u>	70342900	7/21/2003 PWM - MOTOR CONTROLLER
<u>SPEED SENSOR</u>		
	70243200	CIRCUIT BOARD SPEED SENSOR
	70243300	SPEED SENSOR SCREW
 <u>DATA CABLE</u>		
	70337900	500Z NON DATA CABLE ,P
	70337800	500Z HRC DATA CABLE
 <u>500 ZT SERIES</u>	70341300	20 PIN DATA CABLE
 <u>DRIVE MOTOR</u>		
	70325500	3HP DRIVE MOTOR
	70341500	500ZT DRIVE MOTOR
 <u>DRV BELT</u>		
	70006300	DRIVE BELT 210J10

ELEVATION MTR

70113200	ELEVATION MOTOR
70183200	ELEVATION START CAPACITOR
70115500	3/8X1 CLEVIS PIN
70116700	COTTER PIN
70013500	10-32 X 3/8 PPH SCREW
70118900	TORQUE ARM SWIVEL PIN

LLS

70121000	LLS
70120500	LLS wire assy. To PWM

ELEVATION RACK

70281002	ELEVATION RISER ASSY.
70154600	ELEVATION BLOCK ASSY.

POWER CORD

70253100	9FT. POWER CORD ER CORD
----------	------------------------------

ON / OFF SWITCH

70251100	ROCKER ON/OFF SWITCH
----------	----------------------

CIRCUIT BREAKER

70017200	15 AMP CIRCUIT BREAKER
----------	------------------------

TREADBELT

70159400	22 X 119 3/4 2PLY TREADBELT
(ZT) 70321800	NEW ZT 20"X112 1/4" TREADBELT

DECK

70157900	FLEX DECK
(ZT) 70324300	500ZT FLEX DECK

FRONT ROLLER

70255400	ADJ. FRONT ROLLER
70352200	NEW NUMBER FOR ROLLER
70190900	ROLLER SCREW 1/4-20 X 2 GRD5 ZINC

REAR ROLLER

70157400	REAR ROLLER
----------	-------------

STRADDLE COVERS

70162110	STRADDLE COVER/ALUM. 54 1/2"
(ZT) 70343700	500ZT STRAD. CVRS. RT.<.
(ZT) 70334000	500ZT STRAD CVR FRONT CAP Rt (Bullet
70334100	500ZT STRAD CVR FRONT CAP LT (Bullet

	70030900	DBL SIDE STICK TAPE 3/8 X 1/16 X 108FT
	70243400	BLUE TAPE-STR. CVR. 1/2 X 150FT. ROLL
	70086700	6X1 SRADDLE COVER SCREW
<u>RAMRAILS</u>		
	70330800	LEFT RAM RAIL
	70330900	RIGHT RAM RAIL
<u>PEDESTAL</u>		
	70325000	PEDESTAL- WELDMENT/ROUNDED
(ZT)	70336900	500ZT PEDESTAL WELMENT
	70304200	pedestal screw for zt
	70156900	RUBBER WEAR STRIP FOR BASE-PED.
<u>FRAME</u>		
	70262401	FRAME WELDMENT/RND. ADJ. ROLLER
(ZT)	70322800	500ZT FRAME WLD/RND. ADJ. FR. ROLL
	70155200	BUMPER FEET
<u>LUBRICATION</u>		
	70348900	LUBE STICK
	70349000	SILICONE PACKET {1 APPLICATION}

540P, HRC, CI (NON Z) PARTS LIST

<u>CONTROL PANEL</u>	<u>PART #</u>	<u>DESCRIPTION</u>
	70237419	540 NON CONTROL BOARD
	70237421	540 P CONTROL BOARD
	70237420	540 HRC CONTROL BOARD
	70237614	540 CI CONTROL BOARD
	70290110	540non overlay
	70289310	540p overlay
	70289410	540hrc overlay
	70290310	540ci overlay
	70177400	SAFETY KEY ASSY.
	70150000	SAFETY SWITCH
<u>PWM</u>	70132500	MOTOR CONTROLLER (PWM)
	70013500	SCREW, 10-32x3/8 PPH TFS Bo
<u>SPEED SENSOR</u>	70243200	SPEED SENSOR
	70243300	SCREW 4-40x1/4 PPH SELF TAPPING
<u>DATA CABLE</u>	70337900	540NON, P DATA CABLE
	70337800	540 HRC DATA CABLE
	70337700	540 CI DATA CABLE
	70104000	SCREW #10x1/2 PPH
<u>DRIVE MOTOR</u>	70325500	3HP. DRIVE MOTOR
	70125700	SCREW 10-32x1/4 PPH TFS Bo
	70155200	BUMPER FEET 1 1/8 x1 1/2
	70176000	3/8 Dbl Coated foam tape Tesa -49
	70013500	SCREW10-32x1/4 PPH TFS Bo
	70125500	5/16-18 NYLOC NUT
	70115200	WASHER 3/8 1Dx7/8odx.083F
	70125600	5/16-18x2 CARRIAGE BOLT
<u>DRV BELT</u>	70006300	POLY-V-BELT DRIVE BELT
<u>ELEVATION MTR</u>	70113200	ELEVATION MOTOR

	70115500	CLEVIS PIN 3/8x1 1/2
	70116700	COTTER PIN 1/16 Dia x 1 5/16
	70013500	SCREW 10-32 x 3/8 PPH TFSBO
	70118900	TORQUE ARM SWIVEL PIN
<u>LLS</u>		
	70121000	LLS
	70125700	SCREW - 10-32x 1/4 PPH TFS BO
	70120500	LLS WIRE ASSY. To PWM
<u>ELEVATION RACK</u>		
	70281003	ELEV. RISER ASSY.
	70154600	ELEV. BLOCK ASSY.
	70122800	SOCKET HD. CAP SCREWS 1/4-20x1
	70183200	INCLINE START CAPACITOR
	70013500	SCREW FOR CAP./10-32x3/8
<u>POWER CORD</u>		
	70253100	POWER CORD 12' 14/3 SJTW BLACK STRT
	70125700	SCREW 10-32x1/4 PPH TFS Bo
<u>ON / OFF SWITCH</u>		
	70251100	ROCKER ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>		
	70290000	BELT 22x119 3/4 ST E5 2Ply-Lo
	70289900	540 ORTHO TREADBELT
<u>DECK</u>		
	70288900	FLEX DECK
	70020200	SCREW 10/32 x 1 1/4 PPH "F"
	70158600	BELT GUIDE
	70019300	SCREW 10x3/4
<u>FRONT ROLLER</u>		
	70275200	ADJ. FRONT ROLLER
	70157000	WASHER INTERNAL TOOTH STAR 1/4 id
	70185300	NYLOC NUT 1/4-10 2 nc
	70190900	HEX BOLT-TAP1/4-20x2 Grd 5/21NC
	70256800	FLAT WASHER .50x.26x.09 2n Pltd.
<u>REAR ROLLER</u>		
	70275500	REAR ROLLER ASSY.
	70159000	INTERNAL TOOTH WASHER 5/16
	70158900	BOLT HEX HEAD TAP, Grd 5-5/16
<u>STRADDLE COVERS</u>		
	70263900	Straddle cover / Plastic

	70030900	TAPE, 3/8x1/16x108ft. DBL stick-49
	70243400	BLUE TAPE -STR. CVR. 1/2x150ft roll
	70086700	6X1 DRYWALL SCREW
<u>RAMRAILS</u>		
	70274105	CHR RAM RAIL
	70210600	#10x3/4 PPH TEK Screw-bo
	70280600	NON CNR RAILS(RAM)
<u>PEDESTAL</u>		
	70288600	PEDESTAL- WELDMENT/ROUNDED
	70156900	RUBBER WEAR STRIPS
<u>FRAME</u>		
	70289700	FRAME WELDMENT/RND. ADJ. FRONT
	70155200	BUMPER FEET
	70020200	SCREW 10/32x1 1/4
	70019300	SCREW 10x3/4 PPHSMBO
	70086700	6x1 DRYWALL SCREW
<u>AUTO WAXER</u>		
	70280800	AUTO WAXER
	70019300	SCREW 10x3/4 PPHSMS Bo
<u>LUBRICATION</u>		
	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)

540Z, ZT, P, HRC, CI PARTS LIST

<u>CONTROL PANEL</u> <u>(540Z's) Overlay only</u>	<u>PART #</u> 70292410	<u>DESCRIPTION</u> 540Z CI Overlay only
<u>(540ZT's)Overlays only</u>	70327510 70327511	540ZT P Overlay Only 540ZT HRC Overlay Only
<u>(540ZT'S)BOARDS</u> <u>ONLY</u>	70328013 70328012 70298612	540ZT P CONTROL BOARD ONLY 540ZT HRC CONTROL BOARD ONLY 540 Z CI CONTROL BOARD
<u>540ZT EX'S BOARDS</u> <u>ONLY International</u>	70328053 70328052	540ZT PEX CONTROL BOARD ONLY 540ZT HRCEX CONTROL BOARD ONLY
<u>ALL 540ZT PANEL</u> <u>ARE THE SAME</u> <u>AS THE REG,</u> <u>540Z</u>	70328102 70328201 70299201 70298900 70331000 70290602	540Z, ZT P PANEL 540Z, ZT HRC PANEL 540Z, ZT CI PANEL PANEL SCREW MAGNET SAFETY KEY Panel Back Cover
<u>OVERLAY</u>		
<u>PWM</u>		
	70132500	PWM MOTOR CONTROLLER
<u>540 ZT SERIES</u>	70342900 70013500	540 ZT MOTOR CONTROLLER PWM SCREW
<u>SPEED SENSOR</u>		
	70243200 70243300	CIRCUIT BOARD SPEED SENSOR SPEED SENSOR SCREW
<u>DATA CABLE</u> <u>ALSO FOR 540ZT</u>	70341300 70337900 70337800 70337700	540 ZT 20 pin Data Cable (Most ZT's) 540Z, ZT P DATA CABLE 540Z, ZT HRC DATA CABLE 6pin & 8pin 540Z, ZT CI DATA CABLE 2 pin & 8 pin
<u>DRIVE MOTOR</u>		
	70325500 70341500	3HP. DRIVE MOTOR 540ZT DRIVE MOTOR
	70125700 70155200 70176000	Screw 10-32x1/4 PPH TFS Bo BUMPER FEET 1 1/16 X 1 1/2 3/8 DBL. COATED FOAM TAPE

	70013500	Screw 10-32x1/4 PPH TFS Bo
	70125500	5/16-18 NYLOC NUT
	70115200	WASHER 3/8 ID X 7/8 OD
	70125600	5/16-18X2 CARRIAGE BOLT
<u>DRV BELT</u>		
	70006300	210J10 DRIVE BELT
<u>ELEVATION MTR</u>		
	70113200	ELEVATION MOTOR
	70115500	3/8 X 1 1/2 CLEVIS PIN
	70116700	COTTER PIN
	70013500	Screw 10-32 x 3/8 PPH TFSBO
	70118900	TORQUE ARM SWIVEL PIN
<u>LLS</u>		
	70121000	LLS
	70120500	LOWER LIMIT SWITCH WIRE
<u>ELEVATION RACK</u>		
<u>(ZT)</u>	70281003	540ZT ELEVATION RISER ASSY.
	70154600	ELEVATION BLOCK ASSY.
<u>POWER CORD</u>		
	70253100	POWER CORD 9FT.
<u>ON / OFF SWITCH</u>		
	70251100	ROCKER ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>		
	70290000	540Z TREADBELT-22 X 108 3/4
	70289900	540Z TREADBELT-22 X 108 3/4 Ortho
<u>(ZT)</u>	70321800	540ZT-22"X112 1/4" TREADBELT
zt	70321900	540ZT ORTHO BELT
<u>DECK</u>		
	70288900	540Z FLEX DECK
<u>(ZT)</u>	70324400	540ZT FLEX DECK
<u>FRONT ROLLER</u>		
	70275200	ADJ. FRONT ROLLER
	70352400	NEW NUMBER ADJ. FRONT ROLLER

REAR ROLLER

70275500 REAR ROLLER

STRADDLE COVERS

70263900 STRADDLE COVER/ALUM. 54 1/2" 55

(ZT)

70343700 540ZT PLASTIC STRAD. CVRS.

70327002 Plastic Insert

70343901 540ZT Alum Side Covers

70030900 3/8X1/16X108FT ROLL DBL. SIDE STICK T

70243400 BLUE TAPE - STR. CVR. 1/2X150FT. ROLL

70329600 SILVER sst tape

70086700 STRADDLE COVER SCREW

RAMRAILS

70330800 LEFT RAM RAIL

70330900 RIGHT RAM RAIL

PEDESTAL

70325100 PEDESTAL-WELDMENT/ROUNDED

(ZT)

70337000 540ZT PEDESTAL WELDMENT

FRAME

70289701 FRAME WELDMENT/ROUNDED ADJ. RO

(ZT)

70322900 540ZT FRAME WELDMENT/RND.

70155200 BUMPER FEET

LUBRICATION

70348900 LUBE STICK

70349000 SILICONE PACKET

550P, HRC PARTS LIST

<u>CONTROL PANEL</u>	<u>PART #</u>	<u>DESCRIPTION</u>
<u>550 Board Only</u>	70237519	550P Board Only
	70237518	550HRC Board Only
	70237610	550CI Board Only
	70279200	550DP/ P DOT/ PANEL
	70279100	550HRC DOT/PANEL
	70279000	550CI DOT/PANEL
<u>OVERLAY</u>	70279201	550DP/ P DOT/OVERLAY
	70279101	550HRC DOT/ OVERLAY
	70150000	Safety Switch Assembly
	70279001	550CI OVERLAY
<u>PWM</u>	70132500	MOTOR CONTROLLER
	70183500	550ci pwm
<u>SPEED SENSOR</u>	70243200	CIRCUIT BOARD SPEED SENSOR
<u>DATA CABLE</u>	70337900	550 P INTERFACE CABLE
	70337800	550 HRC INTERFACE CABLE
	70337700	550 CI INTERFACE CABLE
<u>DRV MTR</u>	70325500	3HP DRIVE MOTOR
<u>DRV BELT</u>	70005300	210J10 POLY-V-BELT
<u>ELEVATION MTR</u>	70113200	ELEVATION MOTOR
<u>LLS</u>	70121000	LOWER LIMIT SWITCH
<u>ELEVATION RACK</u>	70281003	ELEVATION RISER ASSY.
<u>POWER CORD</u>	70253100	9FT. POWER CORD
	70008200	STRAIN RELIEF BUSHING
<u>ON/OFF SWITCH</u>	70251100	ON/OFF ROCKER SWITCH
<u>CIRCUIT BREAKER</u>	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>	70278800	22X119 3/4" 2PLY TREADBELT
<u>550CI BELT</u>	70278900	22x119 3/4" 2PLY TREADBELT ORTHO
<u>DECK</u>	70278700	FLEX DECK
<u>FRONT ROLLER</u>	70352400	ADJ. FRONT ROLLER
<u>REAR ROLLER</u>		

70352000 REAR ROLLER

STRADDLE COVERS

70162109 LT. AND RT.ALUM. STRADDLE COVER

PEDESTAL

70277600 PEDESTAL-WELDMENT/ROUNDED

FRAME

70278000 ADJ. FR. ROLLER FRAME/WELDMENT

LUBRICATION

70348900 LUBE STICK

70349000 SILICONE PACKET (1 APPLICATION)

550Z, P, HRC, CI PARTS LIST

<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>	
<u>BOARD ONLY</u>	70288217 550Z P BOARD ONLY
<u>550Z ONLY</u>	70288218 550Z HRC BOARD ONLY
	70288613 550Z CI BOARD ONLY
	70282415 550Z P OVERLAY
	70334400 550Z P PANEL
	70334500 550Z HRC PANEL
	70329900 550Z CI PANEL
	70331000 MAGNET SAFETY KEY
<u>PWM</u>	
	70132500 PWM MOTOR CONTROLLER
	70013500 PWM SCREW
<u>SPEED SENSOR</u>	
	70243200 CIRCUIT BOARD SPEED SENSOR
	70243300 SPEED SENSOR SCREW
<u>DATA CABLE</u>	
	70337900 550Z P DATA CABLE
	70337800 550Z HRC DATA CABLE
	70337700 550Z CI DATA CABLE
<u>DRIVE MOTOR</u>	
	70325500 3HP DRIVE MOTOR
<u>DRV BELT</u>	
	70006300 210J10 DRIVE BELT
<u>ELEVATION MTR</u>	
	70113200 ELEVATION MOTOR
	70183200 ELEV. MTR. START CAPACITOR
	70115500 3/8 X 1 1/2 CLEVIS PIN
	70116700 1/16 DIA X 1 5/16 COTTER PIN
	70013500 Screw 10-32 x 3/8 PPH TFSBO
	70118900 TORQUE ARM SWIVEL PIN
<u>LLS</u>	
	70121000 LLS
	70120500 LOWER LIMIT SWITCH WIRE
<u>ELEVATION RACK</u>	
	70281003 ELEVATION RISER ASSY.
	70154600 ELEVATION BLOCK ASSY.

<u>POWER CORD</u>	70253100	POWER CORD 9FT.
<u>ON / OFF SWITCH</u>	70251100	ROCKER ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>	70276800	22X118 3/4 2PLY TREADBELT
	70276900	Belt Seig 22x118 3/4 550 Ortho
<u>DECK</u>	70276700	FLEX DECK
<u>FRONT ROLLER</u>	70352400	ADJ. FRONT ROLLER
<u>REAR ROLLER</u>	70352000	REAR ROLLER
<u>STRADDLE COVERS</u>	70162110	STRADDLE CVR/ALUM 54 1/2"
	70030900	3/8X1/16X108FT. DBL. STICK TAPE
	70243400	1/2X150FT ROLL BLUE TAPE
	70086700	6X1 STRADDLE COVER SCREW
<u>RAMRAILS</u>	70330800	LEFT RAM RAIL
	70330900	RIGHT RAM RAIL
<u>CARRIAGE ASSY. 550Z CI</u>	70240900	ADJ. MOTOR ASSY 550Z CI
	70241100	COVER PAN-WELDMENT
	70239200	SHAFT
	70250700	LIMIT SWITCH ASSY.-STOP 550CI
	70249900	S.O.F.T. SELECT POWER CABLE
	70280000	INTERFACE CABLE-ASSY.550Z CI
	70280400	ADJ. CARRIAGE ASSY. 550Z CI
	70252300	CIRCUIT BOARD INTERFACE 550Z CI
<u>PEDESTAL</u>	70325104	PED-WELDMENT/ROUNDED HRC
	70325105	PED-WELDMENT/ROUNDED P
<u>FRAME</u>	70276000	FRAME WELDMENT/RND-ADJ ROLLER
	70155200	BUMPER FEET
<u>LUBRICATION</u>	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)

550 ZTX, P, HRC, CI PARTS LIST

	<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>		
<u>(550ZTX's) Overlay only</u>	70292415	550ZTX P Overlay only
	70292413	550ZTX HRC Overlay only
	70292414	550ZTX CI Overlay Only
<u>Control Board Only</u>	70298216	550ZTX P CONTROL Board Only
	70298215	550ZTX HRC CONTROL Board Only
	70298611	550ZTX CI CONTROL Board Only
<u>International Version</u>	70298256	550ZTX PEX CONTROL Board Only
	70298255	550ZTX HRCEX CONTROL Board Only
	70298651	550ZTX CIEX CONTROL Board Only
<u>Panel Assy.</u>	70299007	550ZTX P CONTROL PANEL
	70298707	550ZTX HRC CONTROL PANEL
	70329900	550ZTX CI CONTROL PANEL
<u>PWM</u>	70342900	MOTOR CONTROLLER
<u>Speed Sensor</u>	70243200	Speed Sensor
<u>DATA CABLE</u>		
<u>500zt</u>	70341300	DATA CABLE HRC
<u>DRV MTR</u>	70341500	3HP 10 MPH DRIVE MOTOR
	70293002	MOTOR COVER
<u>DRV BELT</u>	70006300	210J10 POLY-V-BELT
<u>ELEVATION MTR</u>	70330100	INCLINE MOTOR ASSY
<u>LLS</u>	70309401	LOWER LIMIT SWITCH
	70120501	LOWER LIMIT SWITCH WIRE TO PWM
<u>ELEVATION RACK</u>	70329300	INCLINE RACK ASSY
<u>POWER CORD</u>	70253100	9FT POWER CORD
	70008200	STRAIN RELIEF BUSHING
<u>CIRCUIT BREAKER</u>	70017200	15 AMP CIRCUIT BREAKER

TREADBELT

70322000	22"X124" TREADBELT
70322100	ORTHO BELT FOR THE 550ZTX CI AND O

DECK

70324500	FLEX DECK
70232700	Bumper

FRONT ROLLER

70352400	ADJ. FRONT ROLLER
----------	-------------------

REAR ROLLER

70352000	REAR ROLLER
----------	-------------

STRADDLE COVERS

70343800	ALUM. STRADDLE COVER RH & LH
----------	------------------------------

RAMRAILS

70330800	LH RAM RAIL
70330900	RH RAM RAIL
70347500	INTERCHANGABLE RAM RAILS RT.<.

PEDESTAL

70325302	PEDESTAL WELDMENT - ARCHED 550ztx hrc
----------	---------------------------------------

FRAME

70337100	FRAME WELDMENT
----------	----------------

LUBRICATION

70348900	LUBE STICK
70349000	SILICONE PACKET (1 APPLICATION)

Model 600-750

Parts List

▣ 600, P, HRC	Page 64
▣ 600Z / 700Z, P, HRC	Page 67
▣ 700, P, HRC (SS100-SS90)	Page 70
▣ 700A, P, HRC	Page 73
▣ 725 P, HRC	Page 76
▣ 750, P, HRC, CI	Page 79

600P, HRC PARTS LIST

<u>CONTROL PANEL</u>	<u>PART #</u>	<u>DESCRIPTION</u>
<u>(600) Board Only</u>	70237412	600NON Board Only
	70237411	600P Board Only
	70237410	600HRC Board Only
	70269900	600NON DOT PANEL 00-PRESENT
	70269901	600P DOT PANEL 00-PRESENT
	70150000	SAFETY SWITCH ASSY.
	70182800	SAFETY KEY ASSY.
<u>OVERLAY</u>	70269910	600NON DOT OVERLAY 00-PRESENT
	70269911	600P DOT OVERLAY 00-PRESENT
	70265011	600HRC DOT OVERLAY 00-PRESENT
<u>PWM</u>	70219200	MOTOR CONTROLLER SS-92 DCI
	70219201	MOTOR CONTROLLER 02-PRESENT
	70013500	PWM SCREW
<u>SPEED SENSOR</u>	70243200	CIRCUIT BOARD SPEED SENSOR
	70243300	SPEED SENSOR SCREW
<u>DATA CABLE</u>	70337900	NON HRC DATA CABLE
	70337800	P DATA CABLE
<u>DRV MTR</u>	70325500	3HP DRIVE MOTOR
	70282700	MOTOR CHOKE ASSY.
	70125500	NYLOCK NUT- 5/16-18 DRIVE MTR.
	70125600	CARRIAGE BOLT -5/16-18 X 2 3/4
<u>DRV BELT</u>	70006300	210J10 POLY-V-BELT
<u>ELEVATION MTR</u>	70113200	ELEVATION MOTOR
	70115500	CLEVIS PIN 3/8 X 1 1/2
	70118900	TORQUE ARM SWIVEL PIN
	70116700	COTTER PIN 1/16 DIA. X1 5/16
	70183200	ELEVATION START CAPACITOR
	70013500	CAPACITOR SCREW 10-32 3/8 PPH
<u>LLS</u>	70121000	LOWER LIMIT SWITCH

	70125700	10-32 X 1/4 PPH SCREW
	70120500	LOWER LIMIT SWITCH WIRE TO PWM
<u>ELEVATION RACK</u>		
	70281002	ELEVATION RISER ASSY.
	70154600	ELEVATION BLOCK ASSY.
	70122800	1/4-20 X 1 SOCKET HD. CAP SCREW
<u>POWER CORD</u>		
	70282900	12 FT. POWER CORD
	70303700	NEMA PLUG
<u>ON / OFF SWITCH</u>		
	70251100	ROCKER ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>		
	70159400	20" X 108" 2 PLY SEIGLING TREADBELT
<u>DECK</u>		
	70157900	FLEX DECK
	70020200	DECK SCREW 10/32 X 1 1/4
<u>BUMPER KIT</u>		
	70155200	BUMPER FEET
	70020200	10/32 X 1 1/4 PPH SCREW
	70232700	FLEX BUMPER
	70086700	BUMPER SCREW 5 X 1
<u>FRONT ROLLER</u>		
(ADJUSTABLE)	70255400	ADJ. FRONT ROLLER
	70188500	BOLT - ADJ. FR.
	70185300	NYLOCK NUT - ADJ. FR.
	70256800	FLAT WASHER
	70190900	BOLT - FR. SOLID MOUNT END / ADJ. FR
<u>REAR ROLLER</u>		
	70157400	REAR ROLLER
	70158900	REAR ROLLER BOLT
	70159000	INTERNAL TOOTH WASHER 5/16
<u>STRADDLE COVERS</u>		
	70162101	STRADDLE COVERS RT. & LT. ALUM.
	70086700	6 X 1 DRYWALL SCREW
	70030900	DBL. STICK TAPE 3/8 X 1/16 X 108FT.
	70243400	BLUE TAPE 1/2 X 150FT.
<u>RAMRAILS</u>		
	70274101	HANDLEBAR ASSY./ RAM - CHR
	70210600	#10 X 3/4 PPH TEK SCREW

REHAB RAILS

70274401	REHAB HANDRAIL ASSY. - CHR
----------	----------------------------

REHAB HARDWARE

70157000	WASHER - INTERNAL STAR
70013500	SCREW 10-32 X 38 PPH
70104000	SCREW # 10 X 1/2 PPH TEK
70122800	SCREW 1/4-20 X 1 SOCKET HEAD CAP
70064500	PLASTIC PLUG

PEDESTAL

70264600	WELDED PEDESTAL 600 NON-CI
70155900	SCREW PED / 1/4-20 X 5/8
70157000	INTERNAL TOOTH STAR WASHER / PED
70269800	BOTTLE HOLDER / MOLDED PLASTIC
70019300	SCREW - BOTTLE HOLDER

FRAME

70262401	FRAME WELDMENT/ROUNDED ADJ. RO
----------	--------------------------------

AUTO WAXER

70280800	600 AUTO WAXER ASSY.
70019300	10 X 3/4 PPHSMS SCREW
70239800	REPLACEMENT WAX CHANNEL ASSY.

LUBRICATION

70348900	LUBE STICK
70349000	SILICONE PACKET (1 APPLICATION)

600Z/ 700Z, P, HRC PARTS LIST

<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>	
<u>(600Z's) Overlays only</u>	70327510 600Z NON/P Overlay Only
	70327511 600Z HRCEX OVERLAY
<u>Board Only 600Z</u>	70328011 600Z NON Control Board Only
	70328010 600Z P
<u>International</u>	70328051 600Z HRCEX Control Board Only
<u>(700Z's) Overlays only</u>	70292412 700Z Overlay only
	70292411 700Z P Overlay only
	70292413 700Z HRC Overlay only
<u>Board Only 700Z</u>	70298412 700Z NON Control Board Only
	70298214 700Z P Control Board Only
	70298213 700Z HRC Control Board Only
<u>International</u>	70298452 700Z NONEX Control Board Only
	70298254 700Z PEX Control Board Only
	70298253 700Z HRCEX Control Board Only
	70290601 PANEL,BOTTOM CONSOLE
	70294301 PANEL LF. HANDLEGRIP LOWER
	70294302 PANEL RT. HANDLEGRIP LOWER
<u>PWM</u>	
	70343000 220 VOLT PWM
	70342900 MOTOR CONTROLLER
<u>SPEED SENSOR</u>	
	70243200 CIRCUIT BOARD SPEED SENSOR
<u>DATA CABLE</u>	
	70341300 20 PIN DATA CABLE
<u>DRV MTR</u>	
	70260800 220 MOTOR
	70341500 3HP 115V DRIVE MOTOR
<u>DRV BELT</u>	
	70006300 210J10 POLY-V-BELT
<u>ELEVATION MTR</u>	
	70260800 220 ELEVATION MOTOR
	70113200 ELEVATION MOTOR

<u>LLS</u>	70121000	LOWER LIMIT SWITCH
<u>ELEVATION RACK</u>	70281002	600Z ELEVATION RISER ASSY.
	70281003	700Z ELEVATION RISER ASSY.
<u>POWER CORD</u>	70303700	12' POWER CORD
<u>ON / OFF SWITCH</u>	70251100	ON/OFF ROCKER SWITCH
<u>CIRCUIT BREAKER</u>	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>	70317300	600Z 20"X108" TREADBELT
	70317400	700Z 22"X119 3/4" TREADBELT
<u>DECK</u>	70157800	600Z FLEX DECK
	70276700	700Z FLEX DECK
<u>FRONT ROLLER</u>	70352200	600Z ADJ. FRONT ROLLER
	70352400	700Z ADJ. FRONT ROLLER
<u>REAR ROLLER</u>	70351800	600Z REAR ROLLER
	70352000	700Z REAR ROLLER
<u>STRADDLE COVERS</u>	70162111	600Z ALUM.STRADDLE CVRS.
	70162110	700Z ALUM. STRADDLE COVERS
<u>RAMRAILS</u>	70330800	LH RAM RAILS
	70330900	RH RAM RAILS

PEDESTAL

70325100	PEDESTAL WELDMENT
----------	-------------------

FRAME

70262405	600Z WLD/RND ADJ. ROLLER FRAME
----------	---------------------------------------

70276003	700Z FRAME W/ ADJ. FR. ROLLER
----------	--------------------------------------

AUTO WAXER

70280800	AUTOWAXER
----------	-----------

LUBRICATION

70348900	LUBE STICK
70349000	SILICONE PACKET (1 APPLICATION)

Replacement Pedestal 70325103!

700P, HRC (SS100-SS90) PARTS LIST

	<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u> <u>(SS100)</u>	70119300	700NON SS100 PANEL 95-96
	70119900	700P SS100 PANEL 95-96
	70179700	700HRC SS100 PANEL 95-95
<u>(97-98 STYLE)</u> <u>Board Only</u>	70132412	700NON SS90 Control Board Only 97-98
	70132411	700P SS90 Control Board Only 97-98
	70132410	700HRC SS90 Control Board Only 97-98
<u>(99-PRESENT)</u> <u>(DOT Control Board)</u>	70237515	700NON 15% DOT Control Board Only 99-Z
	70237514	700P 15% DOT Control Board Only 99-Z
	70237513	700HRC 15% DOT Control Board Only 99-Z
<u>OVERLAY</u> <u>(SS100 STYLE)</u>	70185400	HEART RATE RECEIVER
	70138500	POLAR CHEST STRAP-HEART RATE
	70273800	CONTACT H R TRANSMITTER
	70182800	SAFETY SWITCH ASSY. 700
	70209700	PUSH BUTTON SAFETY SWITCH SS90 TON SAFETY SWITCH SS90
<u>(97-98 STYLE)</u>	70119301	700NON SS100 OVERLAY 95-96
	70119901	700P SS100 OVERLAY 95-96
	70179701	700HRC SS100 OVERLAY 95-96
<u>(97-98 STYLE)</u>	70160815	700NON SS90 OVERLAY 97-98
	70160816	700P SS90 OVERLAY 97-98
	70160814	700HRC SS90 OVERLAY 97-98
<u>(99-PRESENT)</u>	70242310	700NON DOT OVERLAY 99-PRESENT
	70242311	700P DOT OVERLAY 99-PRESENT
	70242312	700HRC DOT OVERLAY 99-PRESENT
<u>PWM</u> <u>(SS100)</u>	70113900	(SS100) MOTOR CONTROLLER
<u>(96-800000-)</u> <u>(PRESENT)</u>	70219200	PWM MOTOR CONTROLLER
<u>SPEED SENSOR</u> <u>(SS90 STYLE-98-)</u>	70162402	SPEED SENSOR SS90

<u>(99-PRESENT)</u>	70243201	SPEED SENSOR 700, P, HRC
<u>DATA CABLE</u>	70337900	700, P DATA CABLE
	70337800	700 HRC DATA CABLE
<u>DRV MTR</u>	70325600	DRIVE MOTOR 3HP W/FLYWHEEL
	70263500	220V DRIVE MOTOR
	70155300	DRIVE PULLEY 1 11/16" DIA.
	70146500	DRIVE PULLEY 12MPH
<u>DRV BELT</u>	70127600	DRIVE BELT 260J10 POLY-V-BELT
<u>ELEVATION MTR</u>	70171500	ELEVATION MOTOR 115V 700, P, HRC
<u>(HARDWARE)</u>	70126200	INCLINE BEARING (FLANGED)
	70118900	SWIVEL PIN/TORQUE ARM
	70115500	CLEVIS PIN 3/8 DIA. 1 1/2 IN. LONG
	70116700	HAIR COTTER PIN .062 DIA.
	70022600	SET SCREW, INCLINE, CONE POINT
<u>LLS</u>	70121000	LOWER LIMIT SWITCH
	70018100	CHERRY SWITCH
	70120500	LOWER LIMIT SWITCH WIRE
<u>ELEVATION RACK</u>	70176700	MOLDED WHEEL 3/8 BEF.AUG.99
<u>(BEFORE AUG99)</u>	70003100	WHEEL BOLT 3/8 BEFORE AUG, 99
<u>AFTER AUG., 99)</u>	70176701	MOLDED WHEEL 2 1/4 AFT.AUG, 99
	70174300	WHEEL BOLT 1/2" AFTER AUG., 99
<u>POWER CORD</u>	70282900	POWER CORD 12 FT.
	70008200	STRAIN RELIEF BUSHING
<u>ON / OFF SWITCH</u>	70251100	ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>	70017200	15 AMP CIRCUIT BREAKER
<u>TREADBELT</u>	70214300	TREADBELT 700, P, HRC
<u>DECK</u>		

	70158000	DECK
	70086700	DECK SUSP. BLOCK SCREW6X1
	70020200	DECK SCREWS 10/32X1 1/4"
<u>FRONT ROLLER</u>		
	70150800	FRONT ROLLER ASSY, 700 W/SS100
<u>(NON-ADJ.)</u>	70164700	FRONT ROLLER 8 MAGNET/NON ADJ
<u>(ADJ. NOV.-00)</u>	70265300	FRONT ROLLER ADJ.-NOV.2000
	70005600	ROLLER SCREW 3/8-16X3/4
	70005500	ROLLER BOLT 3/8X16X3 HX HD. BOLT
<u>REAR ROLLER</u>		
	70186000	REAR ROLLER SS90
	70005600	ROLLER SCREW 3/8-16X3/4
	70005500	ROLLER BOLT 3/8X16X3 HX HD. BOLT
	70073900	OLD STYLE
<u>STRADDLE COVERS</u>		
	70162107	STRADDLE COVER-ALUM.-46 13/16"
	70030901	3/8 X1/16 X 36YD. DBLE STK TAPE 16'
<u>RAMRAILS</u>		
	70204200	RAMRAIL HANDLE BAR
	70104000	RAIL SCREWS #10-32X3/8
<u>PEDESTAL</u>		
	70233500	PEDESTAL-99-00 700,700P,700HRC
	70207800	BOLT - PED 3/8" - 16 X 3/4"
<u>AUTO WAXER</u>		
	70167000	AUTOWAXER - ASSY
	70239800	WAX CHANNEL (ONLY)
	70342000	GRND. WIRE FOR WAXER
<u>LUBRICATION</u>		
	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)

700A, P, HRC PARTS LIST

<u>WEIGHT</u>	<u>PART #</u>	<u>DESCRIPTION</u>
	70298413	700A NON Board Only
	70237517	700A P Board Only
	70237516	700A HRC Board Only
	70311700	700A DOT PANEL ASSY.
	70312100	700A P DOT PANEL ASSY.
	70312000	700A HRC DOT PANEL ASSY.
	70240505	EXTRUSION PANEL CLIP28 3/4" LG
	70020300	SCREW 6-32x3/8 PPHMS BLK OX
	70182800	SAFETY SWITCH
	70242313	700A DOT /OVERLAY
	70279201	700A P DOT/OVERLAY
	70279101	700A HRC DOT/OVERLAY
3lbs.	70219200	MOTOR CONTROLLER 5592/DCI (Green)
	70219201	MOTOR CONTROLLER (02)
	70013500	SCREW, 10-32x3/8 PPH TFS Bo
	70282700	CHOKE ASSY.
1lbs.	70243200	SPEED SENSOR
	70243300	SCREW 4-40x1/4 PPH SELF TAPPING
	70337900	NON HRC DATA CABLE
	70337800	AP, HRC
44lbs.	70325500	3HP. DRIVE MOTOR
	70125700	SCREW 10-32x1/4 PPH TFS Bo
	70176000	3/8 DBL. COATED FOAM TAPE TESA -49
	70013500	SCREW 10-32x1/4 PPH TFS Bo
	70125500	5/16-18 NYLOC NUT
	70115200	WASHER 3/8 1Dx7/8odx.083F
	70125600	5/16-18x2 CARRIAGE BOLT

	70006300	DRIVE BELT
10lbs.	70113200	ELEVATION MOTOR
	70183200	INCLINE START CAPACITOR
	70013500	SCREW FOR CAP. /10-32x3/8
	70115500	CLEVIS PIN 3/8x1 1/2
	70116700	COTTER PIN 1/16 Dia x 1 5/16
	70013500	SCREW 10-32 x 3/8 PPH TFSBO
	70118900	TORQUE ARM SWIVEL PIN
	70121000	LLS
	70125700	SCREW - 10-32x 1/4 PPH TFS BO
	70120500	LLS WIRE ASSY. To PWM
26lbs.	70281003	ELEV. RISER ASSY.
	70122800	SOCKET HD. CAP SCREW 1/4-20x1
	70303700	POWER CORD 12' 14/3 SJTW Black STRT
	70125700	SCREW 10-32x1/4 PPH TFS Bo
	70013500	SCREW 10-32x3/8 PPH TFS Bo
	70251100	ROCKER ON/OFF SWITCH
	70017200	15 AMP CIRCUIT BREAKER
9lbs.	70317400	BELT 22x119 3/4 ST E5 2Ply-Lo
60lbs.	70276700	FLEX DECK
	70020200	SCREW 10/32 x 1 1/4 PPH "F" z1
	70158600	BELT GUIDE
	70019300	SCREW 10x3/4
9lbs.	70275200	ADJ. FRONT ROLLER
	70352400	NEW NUMBER ADJ. FRONT ROLLER
	70157000	INTERNAL TOOTH STAR WASHER 1/4 id
	70185300	NYLOC NUT 1/4-10 2 no
	70256800	FLAT WASHER .50x.26x.09 2n Plod.
13lbs.	70275500	REAR ROLLER ASSY.
	70159000	INTERNAL TOOTH WASHER 5/16

	70158900	BOLT HEX HEAD TAP, Gird 5-5/16
	70162109	STRADDLE COVER/ALUM. 54 1/2" 55
	70031200	TAPE 1/2"x18yd. Adhesive
	70030900	TAPE, 3/8x1/16x108ft. DBL stick-49
	70243400	BLUE TAPE -STR. CVR. 1/2x150ft roll
	70086700	6x1 DRYWALL SCREW
	70274105	CHR RAM RAIL
	70280600	NON CHR RAIL (ram)
	70210600	#10x3/4 PPH TEK Screw-boo
	70277601	PEDESTAL- WELDMENT/ROUNDED
	70156900	RUBBER WEAR STRIPS
	70276003	FRAME WLDMNT.
	70155200	BUMPER FEET
	70020200	SCREW 10/32x1 1/4
	70019300	SCREW 10x3/4 PPHSMBO
	70086700	6X1 DRYWALL SCREW
1lbs.	70280800	AUTO WAXER
	70019300	SCREW 10x3/4 PPHSMS Bd
	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)

725P, HRC PARTS LIST

<u>PART #</u>	<u>DESCRIPTION</u>
<u>CONTROL PANEL</u>	
<u>(98 STYLE)</u>	
<u>Board Only</u>	
70132412	725 NON CONTROL Board Only-SS90 (98)
70132411	725P CONTROL Board Only-SS90 (98)
70132410	725HRC CONTROL Board Only-SS90 (98)
<u>(99-00 STYLE)</u>	
<u>Board Only</u>	
70237512	725 NON DOT CONTROL Board Only (99-00)
70237511	725P DOT CONTROL Board Only (99-00)
70237510	725HRC DOT CONTROL Board Only (99-00)
70182800	SAFETY KEY ASSY.
70185400	HEART RATE RECEIVER
70138500	HEART RATE POLAR CHEST STRAP
70239800	HEART RATE TRANSMITTER
70245100	PLASTIC COVER -HR CONTROL
<u>OVERLAYS</u>	
<u>(98 STYLE)</u>	
70160815	725 NON OVERLAY-SS90 (98)
70160816	725P OVERLAY-SS90 (98)
70160814	725HRC OVERLAY-SS90 (98)
<u>(99- 00 STYLE)</u>	
70242310	725 NON DOT/OVERLAY (99-00)
70242311	725P DOT/OVERLAY (99-00)
70242312	725 HRC DOT/OVERLAY (99-00)
<u>PWM</u>	
70219200	MOTOR CONTROLLER 5592/DCI(Green)
70219201	MOTOR CONTROLLER WITH CHOKE (02)
70013500	SCREW, 10-32x3/8 PPH TFS Bo
70282700	CHOKE ASSY.
<u>SPEED SENSOR</u>	
70243201	SPEED SENSOR
70243300	SCREW 4-40x1/4 PPH SELF TAPPING
<u>DATA CABLE</u>	
70337900	725, P DATA CABLE
70337800	725 HRC DATA CABLE
<u>DRV MTR</u>	
70325800	MED. MOTOR

	70325600	DRIVE MOTOR 3 HP.
	70125700	MOTOR SCREW
	70125600	CARRIAGE BOLT 5/16-18X2"
	70125500	NYLOC NUT-5/16-18
	70115200	WASHER-3/8 ID. X 7/8 OD.
	70219601	MOTOR ISOLATION KIT (725)
<u>DRV BELT</u>		
	70127600	DRIVE BELT 260J10
<u>ELEVATION MTR</u>		
<u>(HARDWARE)</u>	70171500	INCLINE MOTOR (HUBBLE)
	70183600	CLEVIS PIN 3/8 X 1 3/4
	70118900	SWIVEL PIN - TORQUE ARM
	70183200	START CAPACITOR
	70013500	CAPACITOR SCREW 10-32X3/8
<u>LLS</u>		
	70121000	LOWER LIMIT SWITCH
	70125700	LOWER LIMIT SWITCH SCREW
	70120500	LOWER LIMIT TO PWM WIRE
<u>ELEVATION RACK</u>		
	70281002	ELEVATION RACK
	70122800	ELEV. SCREW 1/4-20X1 SOCKET HEAD
	70116900	LOCK NUT 1/4-20 ZINC/COURSE-THREAD
	70176700	MOLDED WHEEL 3/8 BEF. AUG., 99
	70003100	MOLDED WHEEL BOLT BEF. AUG., 99
	70176701	MOLDED WHEEL 1/2 AFTER AUG., 99
	70174300	MOLDED WHEEL BOLT AFTER AUG., 99
<u>POWER CORD</u>		
	70282900	12 FT. POWER CORD
<u>ON / OFF SWITCH</u>		
	70251100	ON/OFF SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	CIRCUIT BREAKER 15 AMP
	70213100	CIRCUIT BREAKER 10 AMP DUAL POLE
<u>TREADBELT</u>		
	70214400	SEIGLING TREADBELT E5X20X129
<u>DECK</u>		
	70159100	FLEX DECK
	70020200	DECK AND BUMPER FEET SCREW
	70155200	DECK BUMPER FEET
<u>FRONT ROLLER</u>		
<u>(BEFORE NOV.00)</u>	70164700	FRONT ROLLER BEFORE NOV.,00

<u>(AFTER NOV.00)</u>	70265300	FRONT ROLLER AFTER NOV.,00-ADJ.
	70207800	ROLLER SCREW 3/8-16X3/4
	70283700	ROLLER BOLT 3/8-16X3 LG.
	70115200	ROLLER WASHER 3/8 IDX7/8 OD
	70253700	3/8 NYLOC NUT
<u>REAR ROLLER</u>	70186000	REAR ROLLER
	70188600	REAR ROLLER BOLT
<u>STRADDLE COVERS</u>	70162106	STRADDLE COVER
	70086700	STRADDLE COVER SCREW
	70030900	STRADDLE COVER TAPE-108FT.DBL.STK.
	70243400	STRADDLE COVER BLUE TAPE150 FT.
<u>RAMRAILS</u>	70274101	RAM RAILS CONTACT HEART RATE
	70210600	RAIL SCREW #10X3/4
<u>PEDESTAL</u>	70233501	PEDESTAL-WELDED
	70155900	RUBBER WEAR STRIP
	70207800	BOLT - PED. 3/8"-16 X 3/4"
	70269800	BOTTLE HOLDER MOLDED PLASTIC
	70019300	BOTTLE HOLDER SCREW 10X3/4
<u>AUTO WAXER</u>	70167000	AUTO WAXER
	70019300	SCREW 10x3/4 PPHSMS BO
	70342000	GROUNDING STRAP ASSY.
	70239800	WAX CHANNEL (ONLY)
<u>LUBRICATION</u>	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)

750P, HRC, CI PARTS LIST

	<u>PART #</u>	<u>DESCRIPTION</u>
<u>(99-PRESENT)</u> <u>BOARD ONLY</u>	70237524	750 BOARD ONLY 99-PRESENT
	70237525	750P BOARD ONLY 99-PRESENT
	70237613	750CI BOARD ONLY 99-PRESENT
<u>GRAY MACHINES ONLY!</u> <u>BOARD ONLY</u>	70219310	750 P Board Only
	70176910	750CI Board Only
	70185400	HRC RECEIVER
	70245100	PLASTIC HR COVER
	70182800	SAFETY KEY/SWITCH
<u>OVERLAY</u> <u>(98 STYLE)</u>	70216212	750NON OVERLAY 1998
	70216211	750P OVERLAY 1998
	70177011	750CI OVERLAY 1998
<u>(99-PRESENT)</u>	70242510	750NON DOT OVERLAY 99-PRESENT
	70242511	750P DOT OVERLAY 99-PRESENT
	70242610	750CI DOT OVERLAY 99-PRESENT
<u>PWM</u>	70183500	MOTOR CONTROLLER-BEFORE 08/00
	70183502	PWM WITH CHOKE-AFTER-08/00
	70264800	MOTOR CONTROLLER- 220V
	70013500	10-32X3/8 SCREW (PWM)
<u>SPEED SENSOR</u>	70243201	CIRCUIT BOARD SPEED SENSOR
	70243300	4-40 X 1/4 SELF TAPPING SCREW
<u>DATA CABLE</u> <u>Verify config.</u> <u>Verify config.</u> <u>Verify config.</u>	70286700	750, P DATA CABLE BEFORE 08/00
	70337700	750 CI DATA CABLE
	70219500	750 non, p data cable '99
	70271700	750B & PB DATA CABLE '00
<u>DRV MTR</u>	70172000	3HP DRIVE MOTOR Core charge added
	70263400	3HP DRIVE MOTOR EX 220V Core charge added
	70169600	DRIVE MOTOR TENSION PLATE
	70159000	5/16 STAR WASHER

	70125700	10-32X1/4 SCREW
	70219701	MOTOR ISOLATION KIT (750)
<u>DRV BELT</u>		
	70127600	260J10 POLY-V-BELT
<u>TREADBELT</u>		
	70214500	TREADBELT/SIEGLING E5X23X128
<u>DECK</u>		
	70169400	DECK 32 1/2 X 58
	70020200	DECK SCREW 10 X 1 1/4
	70183400	DECK BUMPER
<u>ELEVATION MTR</u>		
<u>(HARDWARE)</u>	70171500	HUBBLE ELEVATION MOTOR
	70183200	CAPACITOR-LIFT MOTOR
	70183600	3/8 X 1 3/4 CLEVIS PIN
	70118900	TORQUE ARM SWIVEL PIN
	70013500	10-32 X 3/8 SCREW
	70116700	1/16DIA. X 15/16 COTTER PIN
<u>LLS</u>		
	70121000	LLS
	70125700	10- 32 X 1/4 Screw for LLS Bracket
	70120500	LLS TO PWM WIRE
<u>ELEVATION RACK</u>		
	70281004	ELEVATION RISER ASSY.
	70154600	ELEVATION BLOCK ASSY.
	70122800	1/4-20 SOCKET HEAD CAP SCREW
	70173900	MACHINED WHEEL 2 1/4" OD.
	70174300	WHEEL BOLT 1/2" X 1 SHOULDER BOLT
<u>POWER CORD</u>		
	70282900	12 FT. POWER CORD
	70008200	STRAIN RELIEF BUSHING
<u>ON / OFF SWITCH</u>		
	70251100	ON/OFF ROCKER SWITCH
<u>CIRCUIT BREAKER</u>		
	70017200	15 AMP CIRCUIT BREAKER
<u>FRONT ROLLER</u>		
	70168000	NON ADJ. FRONT ROLLER
	70265400	ADJ. FRONT ROLLER
	70207800	SCREW 3/8-16 X 3/4
<u>REAR ROLLER</u>		
	70168300	REAR ROLLER
	70170800	1/2- 13 X 4" TAP BOLT

	70170900	1/2INTERNAL TOOTH STAR WASHER
<u>STRADDLE COVERS</u>		
	70171800	RT. AND LT. STRADDLE COVER
	70243400	BLUE TAPE, STR CVR 1/2 X 150 FT ROLL
	70086700	6 X 1 DRYWALL SCREW
	70030900	DOUBLE STICK TAPE 3/8 X 1/16 X 108 Ft
<u>RAMRAILS</u>		
	70165100	RAM HANDLE BAR
	70210600	#10 X 3/4 SCREW
<u>PEDESTAL</u>		
	70233601	ROUNDED PEDESTAL WELDMENT
	70156900	RUBBER WEAR STRIP
	70259800	BOTTLE HOLDER
	70019300	BOTTLE HOLDER SCREW 10X3/4
<u>FRAME</u>		
	70227501	FRAME WELDMENT/ROUNDED GRAY
	70155200	BUMPER FEET
	70020200	BUMPER FEET SCREWS
	70164500	BUMPON DECK BUMPER
<u>AUTO WAXER</u>		
	70167000	AUTOWAXER
	70019300	AUTOWAXER SCREW, 10 X 3/4
	70342000	GROUNDING STRAP ASSY. WAX CHANNEL
<u>LUBRICATION</u>		
	70348900	LUBE STICK
	70349000	SILICONE PACKET (1 APPLICATION)