

	Troubleshooting Guide: Error 0x01A0		
Prepared by: Sophia Her	Date Prepared: 12/24/15	Effective Date: 2/23/11	Models Affected: S70 (EP78)

PROBLEM

The console shows error 0x01A0 (Class C). This mostly occurs when the elevation is changed.

SOLUTION

Check all connections made in assembly (see assembly guide) or related to the incline motor at the MCB.

If the technician is on site, manually recalibrate the incline motor:

1. Press and hold the resistance + and - buttons for approximately three seconds. The console will beep three times and enter the engineering menu.
2. Use the + or - button to navigate to the option "Incline Cal".
3. Press and hold the Enter button for three seconds.
4. Once calibration is complete, press and hold the Start button for three seconds.

If the problem persists, replace the incline motor.